

# **Attachment A4**

|                                         |
|-----------------------------------------|
| <b>Arboricultural Impact Assessment</b> |
|-----------------------------------------|

# 43-49 Mountain Street Ultimo Arboricultural Impact Assessment

Prepared for Apt Residential



## Document Tracking

|                       |                                                               |
|-----------------------|---------------------------------------------------------------|
| <b>Project Name</b>   | 43-49 Mountain Street Ultimo Arboricultural Impact Assessment |
| <b>Project Number</b> | AIA2502175                                                    |
| <b>Prepared by</b>    | Alex de Jong – AQF Level 5 Arborist                           |
| <b>Status</b>         | Final                                                         |
| <b>Version</b>        | v4                                                            |
| <b>Last saved on</b>  | 10 June 2025                                                  |

This report should be cited as 'Arbor Express 43-49 Mountain Street Ultimo Arboricultural Impact Assessment prepared for Apt Residential'

## ACKNOWLEDGEMENTS

This document has been prepared by Arbor Express Pty Ltd with support from Apt Residential

---

### *Disclaimer*

*I do not assume responsibility for liability associated with the tree on/or adjacent to this project site, the future demise and/or any damage which may result therefrom. They take care to obtain all information from reliable sources. All data has been verified insofar as possible; however, the consultant can neither guarantee nor be responsible for the accuracy of information provided by others. I cannot be held responsible for any consequences as result of work carried out outside specifications, not in compliance with Australian Standards or by inappropriately qualified staff. If further investigations such as, aerial, drill and root tests are recommended, the report shall not be considered final until all investigations have been completed as further defects may be found. I have made every effort to accurately identify the current tree health and hazards. Results may or may not correlate to actual tree structural integrity. There are many factors that may contribute to limb or total tree failure, not all these symptoms are visible. There can be hidden defects that may result in a failure even though it would seem that other, more obvious defects would be the likely cause of failure. All standing trees have an element of unpredictable risk. The inspection was limited to a visual ground examination of the tree, without aerial inspections and below ground excavations. The assessments are limited and do not include specialized analysis. No internal diagnostics, aerial inspection and pathology test were conducted. Sketches, diagrams, graphs and photographs in this report, being intended as visual aids, are not necessarily to scale.*

---

## Table of Contents

|    |                                                                     |           |
|----|---------------------------------------------------------------------|-----------|
| 1. | <b>Introduction .....</b>                                           | <b>5</b>  |
| 2. | <b>Method .....</b>                                                 | <b>6</b>  |
| 3. | <b>Tree Schedule .....</b>                                          | <b>9</b>  |
| 4. | <b>Arboricultural Impact Assessment.....</b>                        | <b>10</b> |
| 5. | <b>Tree Protection Plan .....</b>                                   | <b>11</b> |
| 6. | <b>Site Photos .....</b>                                            | <b>12</b> |
| 7. | <b>Recommendations .....</b>                                        | <b>14</b> |
| 8. | <b>Construction Hold Points for Tree Protection .....</b>           | <b>16</b> |
| 9. | <b>References.....</b>                                              | <b>17</b> |
|    | <b>Appendix A: Glossary of Terms.....</b>                           | <b>18</b> |
|    | <b>Appendix B: Retention Value .....</b>                            | <b>20</b> |
|    | <b>Appendix C: Safe Useful Life Expectancy (SULE) .....</b>         | <b>21</b> |
|    | <b>Appendix D: Tree Protection Guidelines .....</b>                 | <b>23</b> |
|    | <b>Appendix E: Encroachment into the Tree Protection Zones.....</b> | <b>26</b> |

## Abbreviations

| Abbreviation | Description                         |
|--------------|-------------------------------------|
| AE           | Arbor Express                       |
| AIA          | Arboricultural Impact Assessment    |
| AQF          | Australian Qualifications Framework |
| AS           | Australian Standards                |
| C            | Canopy                              |
| DAB          | Diameter Above Buttress             |
| DBH          | Diameter at Breast Height           |
| H            | Height                              |
| m            | Metre                               |
| mm           | Millimetre                          |
| NDE          | Non-Destructive Excavation          |
| NO           | Number                              |
| NSW          | New South Wales                     |
| SRZ          | Structural Root Zone                |
| TPP          | Tree Protection Plan                |
| TPZ          | Tree Protection Zone                |
| VTA          | Visual Tree Assessment              |



## 1. Introduction

This AIA has been prepared for Apt Residential in relation to a proposed development at 43-49 Mountain Street Ultimo. The address of the subject site is in Table 1 and mapped in Figure 1. The purpose of this report is to:


- Identify the trees within the site and adjacent surrounding area that are likely to be affected by the proposed development.
- Undertake a visual tree assessment of the subject trees.
- Assess the current overall health and condition of the subject trees.
- Evaluate the retention value of the subject trees.
- Identify trees to be removed, retained or transplanted.
- Determine the likely impacts of trees to be retained.
- Recommend tree protection measures to minimise the impacts to retained trees.
- Preparation of a tree protection plan for trees to be retained (if applicable).

Features of the subject site are tabulated below.

Table 1: Development site

| Criteria                | Description                                 |
|-------------------------|---------------------------------------------|
| Street address          | 43-49 Mountain Street Ultimo                |
| Local government area   | City of Sydney                              |
| Land zoning             | MU1: Mixed Use                              |
| Biodiversity values map | The site is not in a high biodiversity area |
| 10/50 entitlement       | The site does not have a 10/50 entitlement  |

Figure 1: Location

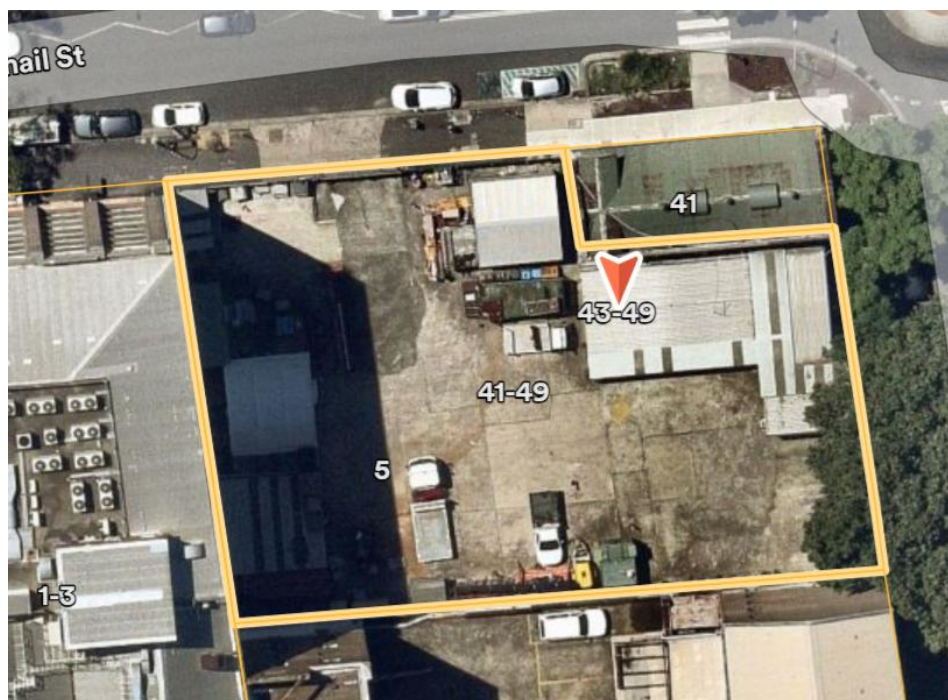

## 2. Method

### Visual Tree Assessment

The subject trees were assessed in accordance with a stage one visual tree assessment (VTA) as formulated by Mattheck and Breloer (1994)<sup>1</sup>, and practices consistent with modern arboriculture.

A total of 4 subject trees were inspected on 1 February 2025.

The following limitations apply to this methodology:

- Trees were inspected from ground level.
- These assessments did not include aerial (climbing) inspections, soil sampling, or root excavations.
- The canopy spread was measured either by estimation or pacing, and the longest span was recorded.
- The height of each tree was estimated.
- Trees were inspected within limits of site access.
- No aerial inspections or root mapping was undertaken.
- Trees located on adjacent properties or in restricted areas were not fully visually inspected, so any defects or abnormalities may not have been documented.
- Tree identification relied on broad taxonomical features visible from ground level at the time of inspection.

### Retention Values

The retention value is the value of retaining a tree or group of trees and is assessed based on a blend of environmental, cultural, physical, and social factors.

- **High:** These trees are deemed worthy of preservation, and their retention should be prioritized. Proposed site designs and the positioning of buildings and infrastructure should take into account the Tree Protection Zones (TPZs) to mitigate any negative effects. Additionally, the extent of the canopy, especially concerning high-rise development, should be taken into consideration. Significantly pruning the trees to accommodate building envelopes or temporary scaffolding is typically not acceptable.
- **Medium:** Retaining these trees is desirable. They should be preserved as part of any proposed development, if feasible. However, these trees are considered less crucial for retention. If their removal becomes necessary, replacement planting should be contemplated in alignment with the Council's Tree Replacement Policy to offset any loss of amenity.
- **Low:** These trees lack significant ecological, heritage, or amenity value, or such values are greatly diminished due to their Safe Useful Life Expectancy (SULE). Therefore, these trees should not be viewed as hindrances to the future development of the site.
- **Very Low:** These trees are regarded as potentially hazardous, very poor specimens, or may even qualify as environmental or noxious weeds. Consequently, their removal is recommended irrespective of any proposed development considerations.

---


<sup>1</sup> Field Guide for Visual Tree Assessment (VTA) by Mattheck, C., and Breloer, H. Arboricultural Journal, Vol 18 pp 1-23 (1994).

### Protection Zones

**Tree Protection Zone (TPZ):** The Tree Protection Zone (TPZ) is fundamental for safeguarding trees on development sites. It encompasses both the root and crown spread, creating a protected space free from construction disturbances to preserve the tree's health and viability.

**Structural Root Zone (SRZ):** The Structural Root Zone (SRZ) defines the space essential for maintaining tree stability, often requiring a larger area to sustain the tree's health. Calculating the SRZ becomes necessary when substantial encroachment into a Tree Protection Zone (TPZ) is proposed. Further analysis through root investigations can provide valuable insights into the extent of these roots.

Figure 2: Tree Protection Zone and Structural Root Zone

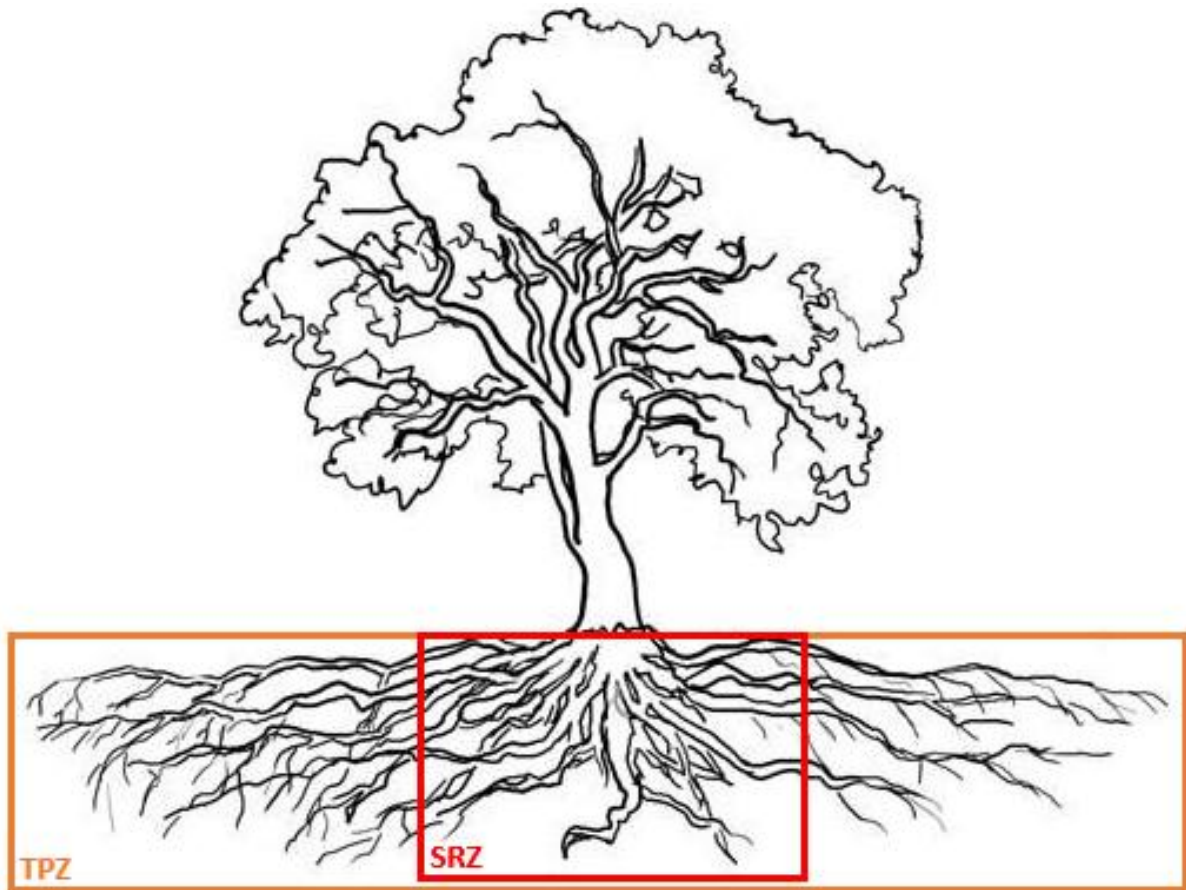




### Impact Assessment

Development activities should be undertaken outside of Tree Protection Zones as much as possible. However, it's recognized that complete avoidance is not always feasible, and some encroachment within these zones may occur due to various reasons. Australian Standard AS 4970-2009, "*Protection of trees on development sites*," offers guidelines for managing such encroachments without necessitating extensive tree management and protection measures. Encroachment parameters are categorized as follows:

- **Minor encroachment:** Detailed root investigations should not be necessary if the proposed encroachment is less than 10% of the TPZ and outside of the SRZ. However, the area lost to this encroachment should be compensated for elsewhere, contiguous with the TPZ.
- **Major encroachment:** If the proposed encroachment exceeds 10% of the TPZ, it is imperative to show that the tree(s) can still thrive. The lost area due to this encroachment should be offset elsewhere, maintaining continuity with the TPZ. Non-destructive root investigations may be necessary for any planned works within this area.


Figure 3: Tree Protection Zone Encroachments

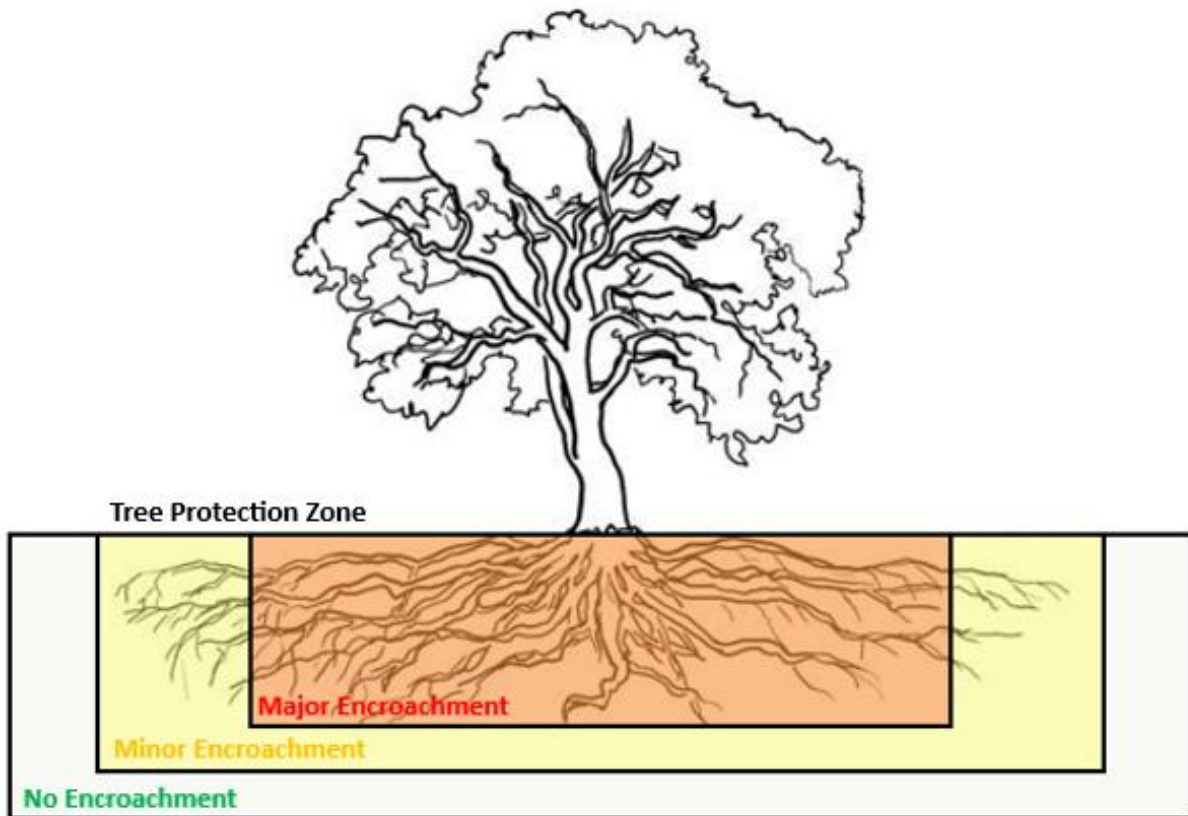

### 3. Tree Schedule

| Tree # | Botanical Name               | Height (m) | Canopy (m) | DBH (mm) | TPZ (m) | SRZ (m) | TPZ Encroachment | SULE | Retention Value | Action | Notes                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                          |
|--------|------------------------------|------------|------------|----------|---------|---------|------------------|------|-----------------|--------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| 1      | <i>Platanus x acerifolia</i> | 33         | 25         | 950      | 11.40   | 3.35    | 26.5%            | 2A   | High            | Remove | <ul style="list-style-type: none"> <li>Canopy in good condition with minimal dieback or deadwood. Parts of the canopy extend into the site of 43-49 Mountain Street that have not been pruned back.</li> <li>Lopsided canopy towards the road.</li> <li>1x cavity on a second order branch (refer to photo 3).</li> <li>Damaged footpath and potential damage to underground services. It is likely that the roots cannot be pruned back to stop the damage as it would destabilise the tree. Refer to ADP report "SYD3482".</li> <li>Impact to vehicles parking on the street next to the tree due to the lean of the trunk. Refer to PDC Consultants (Aust) report "24.173r02v02"</li> </ul> |
| 2      | <i>Jacaranda mimosifolia</i> | 11         | 5          | 190      | 2.30    | 1.82    | 0.0%             | 2A   | Moderate        | Retain | <ul style="list-style-type: none"> <li>Poor canopy structure.</li> <li>Fair condition.</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                              |
| 3      | <i>Jacaranda mimosifolia</i> | 11         | 10         | 380      | 4.60    | 2.40    | 0.0%             | 2A   | Moderate        | Retain | <ul style="list-style-type: none"> <li>Fair condition no major defects identified.</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                  |
| 4      | <i>Celtis australis</i>      | 4          | 2          | 40       | 2.00    | 1.50    | 100.0%           | 3A   | Low             | Remove | <ul style="list-style-type: none"> <li>In very poor condition with dieback throughout the canopy.</li> </ul>                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                   |

## 4. Arboricultural Impact Assessment

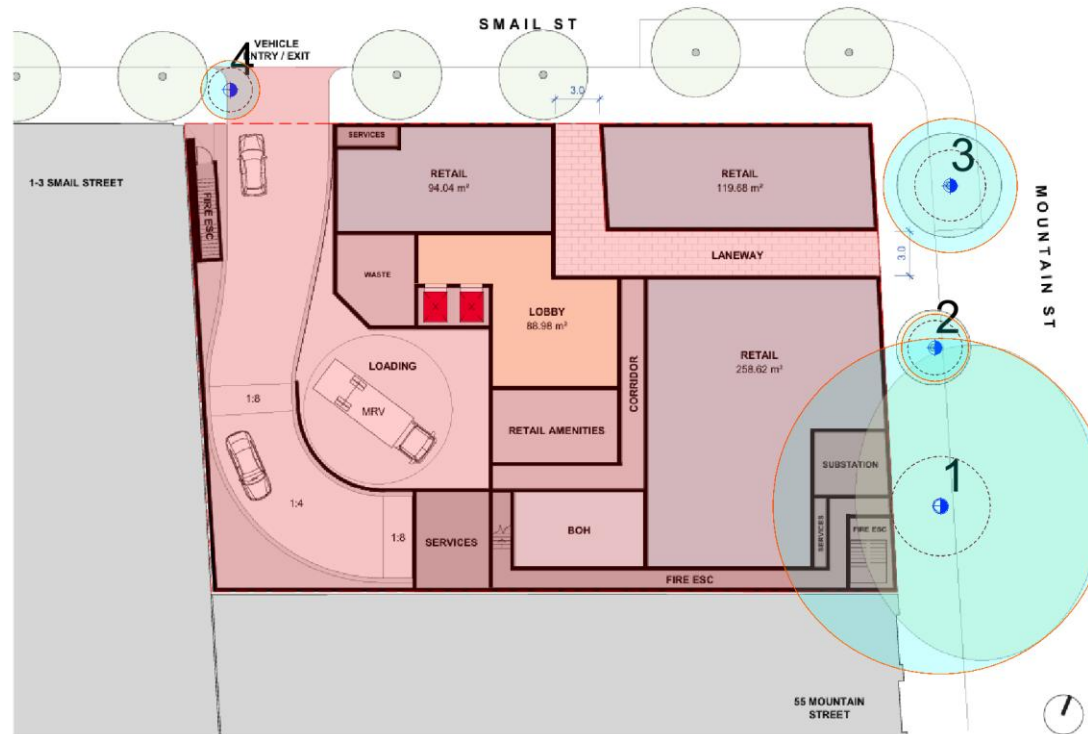


43-49 MOUNTAIN STREET ULTIMO

### Legend

- Tree Protection Zone  Tree Protection Zone Encroachment 
- Structural Root Zone 

## 5. Tree Protection Plan

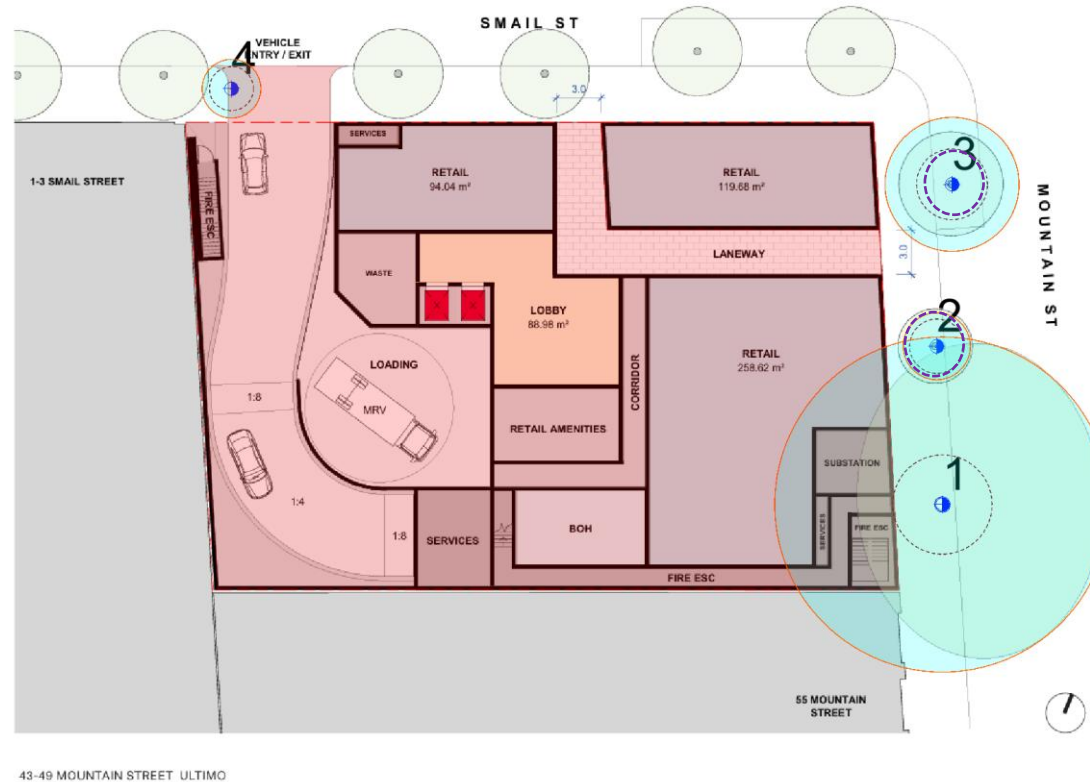

### Legend

Trunk Protection





## 6. Site Photos

Photo 1: Tree 1



Photo 2: Tree 1 – Canopy Required for Pruning



Photo 3: Tree 1 - Cavity



Photo 4: Tree 2





Photo 5: Tree 3

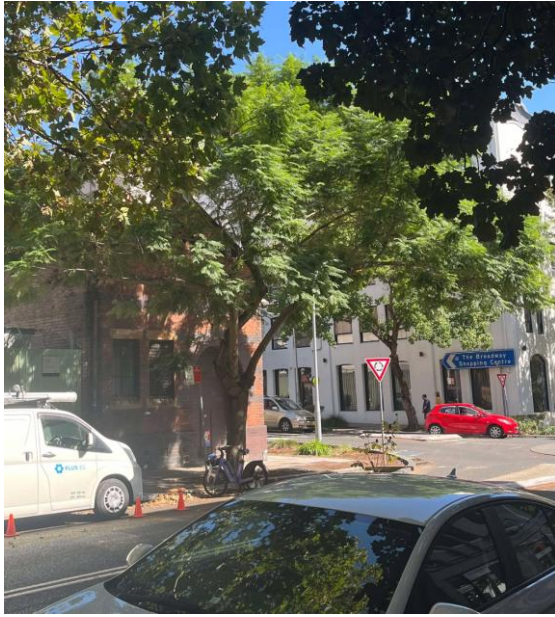


Photo 6: Tree 4



## 7. Recommendations

Following our assessment, the following tree management recommendations are proposed:

- **Tree 1 (*Platanus x acerifolia*):** City of Sydney Council have agreed to approve the removal of Tree 1 due to the future safe useful life of the tree. Refer to the below email from Sally Peters (City of Sydney – Mgr Central Sydney Planning) regarding Tree 1.

**From:** Sally Peters <speters@cityofsydney.nsw.gov.au>

**Date:** Wednesday, 14 May 2025 at 1:51 pm

**To:** Guy Lake <glake@batessmart.com>

**Cc:** Matt Carolan <matt.carolan@aptresidential.au>, Juey Thanyakittikul <juey.thanyakittikul@aptresidential.au>, Michelle Cramsie <MCramsie@cityofsydney.nsw.gov.au>, Jesse McNicoll <jMcNicoll@cityofsydney.nsw.gov.au>, Andrew Harvey <aharvey@urbis.com.au>

**Subject:** 41-49 Mountain Street, Ultimo

Hi Guy,

Further to our brief discussion late last week.

The City has conducted a detailed inspection of the plane tree in Mountain Street, and have found that the tree has multiple defects resulting from cockatoo damage to create breeding hollows. We expect that the damage and decay to this tree will progress, and reduce the future safe useful life of the tree.

As a result of this investigation, we do not object to the removal and replacement of the tree.

If you would like to meet to discuss design options in light of this outcome, please let us know.

Regards,

Sally

Sally Peters  
Mgr Central Sydney Planning  
Strategic Planning & Urban Design



Telephone: +612 9265 9465

Mobile: +61 477 308 431

cityofsydney.nsw.gov.au



The City of Sydney acknowledges the Gadigal of the  
Eora nation as the Traditional Custodians of our local area.

\_\_\_\_\_ This email and any files transmitted with it are intended solely for the use of the addressee(s) and may contain information that is confidential or subject to legal privilege. If you receive this email and you are not the addressee (or responsible for delivery of the email to the addressee), please note that any copying, distribution or use of this email is prohibited and as such, please disregard the contents of the email, delete the email and notify the sender immediately.

- **Tree 2 (*Jacaranda mimosifolia*):** This tree remains structurally stable, and the proposed development does not encroach into its TPZ. With appropriate protection measures in place, Tree 2 can be retained.
- **Tree 3 (*Jacaranda mimosifolia*):** Similar to Tree 2, there is no significant encroachment into the TPZ, and the tree is in good health. Tree 3 should be retained and protected.
- **Tree 4 (*Celtis australis*):** As a recently planted juvenile tree, Tree 4 will be directly impacted by the proposed vehicle entry and exit. Given the extent of disturbance, Tree 4 cannot be retained and should be removed.

To safeguard the retained trees (Trees 2 and 3), all excavation within their TPZs must be carried out using non-destructive techniques, such as Air Spade or vacuum excavation (below 1000 PSI), under the supervision of the Project Arborist. Any structural roots exceeding 25mm in diameter must be preserved. If pavement works are required in proximity to these trees, design adjustments should be made to prevent damage to the existing root system.

Implementing these measures will help mitigate construction-related impacts while ensuring the stability of trees that are suitable for retention.

## 8. Construction Hold Points for Tree Protection

### Project Arborist

Below is a sequence of hold points requiring project arborist certification throughout the development process. It provides a list of hold points that must be checked and certified. All certifications must be provided in written format upon completion of the development. The final certification must include details of any instructions for remediation undertaken during the development. The principle contractor should be responsible for implementation of all tree protection requirements.

| Hold Point                                                                                                                                                                                                                                                                                                                 | Stage                                | Date Completed and Signature of Project Arborist Responsible |
|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------|--------------------------------------------------------------|
| Project Arborist to hold pre construction site meeting with principle contractor to discuss methods and importance of tree protection measures and resolve any issues in relation to feasibility of tree protection requirements that may arise. Project Arborist to mark all trees approved for removal under DA consent. | Prior to development work commencing |                                                              |
| Project Arborist to assess and certify that tree protection has been installed in accordance with AS 4970-2009 prior to works commencing at site.                                                                                                                                                                          | Prior to development work commencing |                                                              |
| In accordance with AS 4970-2009 the Project Arborist should carryout regular site inspections to ensure works are carried out in accordance with the recommendations. Site inspections are recommended on a monthly frequency.                                                                                             | On-going through the development     |                                                              |
| The removal of existing structures inside the TPZ of any tree to be retained, such as the existing buildings and hard surfaces must be supervised by the Project Arborist.                                                                                                                                                 | Demolition                           |                                                              |
| Project Arborist to supervise all manual excavations and root pruning inside the TPZ of any tree to be retained. Project Arborist to approve all pruning of roots greater than 30mm inside TPZ. All root pruning of roots greater than 30mm in diameter must be carried out by an AQF level 5 Arborist.                    | Construction                         |                                                              |
| Project Arborist to certify that all underground services including storm water inside TPZ of any tree to be retained have been installed in accordance with AS 4970-2009.                                                                                                                                                 | Construction                         |                                                              |
| Project Arborist to approve relocation of tree protection for landscaping. All landscaping works within the TPZ of trees to be retained are to be undertaken in consultation with the Project Arborist to minimise the impact to trees.                                                                                    | Construction / Landscape             |                                                              |
| After all demolition, construction and landscaping works are complete the Project Arborist should assess that the subject trees have been retained in the same condition and vigour. If changes to condition are identified the project Arborist should provide recommendations for remediation.                           | Upon completion of the development   |                                                              |

## 9. References

- Barrell, J. 2001. 'SULE: Its use and status into the new millennium', in *Management of mature trees, Proceedings of the 4th NAAA Tree Management Seminar*, NAAA, Sydney.
- Brooker M.I.H, Kleinig D.A. 2006. *Field Guide to Eucalypts*. Volume 1, South-eastern Australia, 3rd ed Blooming Books, Melbourne
- Draper, B. and Richards, P., 2009. *Dictionary for Managing Trees in Urban Environments*, Institute of Australian Consulting Arboriculturists (IACA), CSIRO Publishing, Collingwood, Victoria, Australia.
- Harris, R.W., Matheny, N.P., and Clark, J.R., 1999. *Arboriculture: integrated management of landscape trees, shrubs, and vines*, Prentice Hall, Upper Saddle River, New Jersey.
- Mattheck, C. and Breloer, H. 1994. 'Field Guide for Visual Tree Assessment' *Arboricultural Journal*, Vol 18 pp 1-23.
- Mattheck, C. 2007. *Updated Field Guide for Visual Tree Assessment*. Karlsruhe: Forschungszentrum Karlsruhe. IACA 2010.
- Robinson L, 2003. *Field Guide to the Native Plants of Sydney*, 3rd ed, Kangaroo Press, East Roseville NSW
- Standards Australia 2003. *Composition, Soil and Mulches, AS 4454 (2003)*, Standards Australia, Sydney.
- Standards Australia 2007. *Australian Standard: Pruning of amenity trees, AS 4373 (2007)*, Standards Australia, Sydney.
- Standards Australia 2009. *Australian Standard: Protection of trees on development sites, AS 4970 (2009)*. Standards Australia, Sydney.



## Appendix A: Glossary of Terms

**Abiotic** - Pertaining to non-living agents, e.g. environmental factors.

**Anchorage** - The system whereby a tree is fixed within the soil, involving cohesion between roots and soil and the development of a branched system of roots which withstands wind and gravitational forces transmitted from the aerial parts of the tree.

**Branch:**

- Primary. A first order branch arising from a stem.
- Lateral. A second order branch, subordinate to a primary branch or stem and bearing sub-lateral branches.
- Sub-lateral. A third order branch, subordinate to a lateral or primary branch, or stem and usually bearing only twigs.

**Branch collar** - A visible swelling formed at the base of a branch whose diameter growth has been disproportionately slow compared to that of the parent stem; a term sometimes applied also to the pattern of growth of the cells of the parent stem around the branch base.

**Cambium** - Layer of dividing cells producing xylem (woody) tissue internally and phloem (bark) tissue externally.

**Canker** - A persistent lesion formed by the death of bark and cambium due to colonisation by fungi or bacteria.

**Compartmentalisation** - The confinement of disease, decay or other dysfunction within an anatomically discrete region of plant tissue, due to passive and/or active defences operating at the boundaries of the affected region.

**Condition** - An indication of the physiological condition of the tree. Where the term 'condition' is used in a report, it should not be taken as an indication of the stability of the tree.

**Crown/Canopy** - The main foliage bearing section of the tree.

**Crown lifting** - The removal of limbs and small branches to a specified height above ground level.

**Crown reduction/shaping** - A specified reduction in crown size whilst preserving, as far as possible, the natural tree shape.

**DAB (Diameter Above Buttress)** - Trunk diameter measured above the root buttress.

**Defect** - In relation to tree hazards, any feature of a tree which detracts from the uniform distribution of mechanical stress, or which makes the tree mechanically unsuited to its environment.

**Dieback** - The death of parts of a woody plant, starting at shoot-tips or root-tips.

**Disease** - A malfunction in or destruction of tissues within a living organism, usually excluding mechanical damage; in trees, usually caused by pathogenic micro-organisms.

**DBH (Diameter at Breast Height)** - Stem diameter measured at a height of 1.4 metres or the nearest measurable point. Where measurement at a height of 1.4 metres is not possible, another height may be specified.

**Deadwood** - Branch or stem wood bearing no live tissues. Retention of deadwood provides valuable habitat for a wide range of species and seldom represents a threat to the health of the tree. Removal of deadwood can result in the ingress of decay to otherwise sound tissues and climbing operations to access deadwood can cause significant damage to a tree. Removal of deadwood is generally recommended only where it represents an unacceptable level of hazard.

**Epicormic shoot** - A shoot having developed from a dormant or adventitious bud and not having developed from a first year shoot.

**Heartwood/false-heartwood** - The dead central wood that has become dysfunctional as part of the aging processes and being distinct from the sapwood.

**Included bark (ingrown bark)** - Bark of adjacent parts of a tree (usually forks, acutely joined branches or basal flutes) which is in face-to-face contact.

**Lions tailing** - A term applied to a branch of a tree that has few if any side-branches except at its end and is thus liable to snap due to end- loading.

**Occlusion** - The process whereby a wound is progressively closed by the formation of new wood and bark around it.

**Pruning** - The removal or cutting back of twigs or branches, sometimes applied to twigs or small branches only, but often used to describe most activities involving the cutting of trees or shrubs.

**Reactive Growth/Reaction Wood** - Production of woody tissue in response to altered mechanical loading; often in response to internal defect or decay and associated strength loss (cf. adaptive growth).

**Ring-barking** - The removal of a ring of bark and phloem around the circumference of a stem or branch, normally resulting in an inability to transport photosynthetic assimilates below the area of damage. Almost inevitably results in the eventual death of the affected stem or branch above the damage.

**Stress** - In plant physiology, a condition under which one or more physiological functions are not operating within their optimum range, for example due to lack of water, inadequate nutrition or extremes of temperature.

**SRZ (Structural Root Zone)** - The area around the base of the tree required for the tree's stability in the ground.

**Topping** - In arboriculture, the removal of the crown of a tree, or of a major proportion of it.

**TPZ (Tree Protection Zone)** - A specified area above and below ground and at a given distance from the trunk set aside for the protection of a tree's roots and crown to provide for the viability and stability of a tree to be retained where it is potentially subject to damage by development.

**Veteran tree** - Tree that, by recognised criteria, shows features of biological, cultural or aesthetic value that are characteristic of, but not exclusive to, individuals surviving beyond the typical age range for the species concerned. These characteristics might typically include a large girth, signs of crown retrenchment and hollowing of the stem.

**Vigour** - The expression of carbohydrate expenditure to growth (in trees).

## Appendix B: Retention Value

| Evaluating Sustainability and Landscape Significance to Determine Retention Value |                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                |
|-----------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Retention Value                                                                   | Criteria and Categories                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |
| <b>High</b>                                                                       | These trees are considered to be worthy of preservation. As such, careful consideration should be given to their retention as a priority. Proposed site design and placement of buildings and infrastructure should consider the TPZ to minimize any adverse impact. In addition to TPZs, the extent of the canopy should also be considered, particularly in relation to a high-rise development. Significant pruning of the trees to accommodate the building envelope or temporary scaffolding is generally not acceptable. |
| <b>Moderate</b>                                                                   | The retention of these trees is desirable. These trees should be retained as part of any proposed development, if possible; however, these trees are considered to be less critical for retention. If these trees must be removed, replacement planting should be considered in accordance with Council's Tree Replacement Policy to compensate for loss of amenity.                                                                                                                                                           |
| <b>Low</b>                                                                        | These trees are not considered to be worthy of any special measures to ensure their preservation, due to current health, condition or suitability. They do not have any special ecological, heritage or amenity value, or these values are substantially diminished due to their SULE. These trees should not be considered as a constraint to future development of the site.                                                                                                                                                 |
| <b>Very Low</b>                                                                   | These trees are considered to be potentially hazardous or very poor specimens or may be environmental or noxious weeds. The removal of these trees is therefore recommended regardless of the implications of any proposed development.                                                                                                                                                                                                                                                                                        |

## Appendix C: Safe Useful Life Expectancy (SULE)

|          | 1 LONG SULE                                                                                                                                                 | 2 MEDIUM SULE                                                                                                                                                 | 3 SHORT SULE                                                                                                                                                  | 4 REMOVALS                                                                                                                   | 5 MOVED OR REPLACED                                                    |
|----------|-------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------|
|          | Long: appeared to be retainable at the time of assessment for over 40 years with an acceptable degree of risk, assuming reasonable maintenance.             | Medium: appeared to be retainable at the time of assessment for 15 to 40 years with an acceptable degree of risk, assuming reasonable maintenance.            | Short: appeared to be retainable at the time of assessment for 5 to 15 years with an acceptable degree of risk, assuming reasonable maintenance.              | Removal: trees which should be removed within the next 5 years.                                                              | Moved or Replaced: Trees which can be readily moved or replaced.       |
| <b>A</b> | Structurally sound trees located in positions that can accommodate future growth.                                                                           | Trees that may only live between 15 and 40 more years.                                                                                                        | Trees that may only live between 5 and 15 more years.                                                                                                         | Dead, dying, suppressed or declining trees through disease or inhospitable conditions.                                       | Small trees less than 5 metres (m) in height.                          |
| <b>B</b> | Trees that could be made suitable for long-term retention by remedial tree care.                                                                            | Trees that may live for more than 40 years but would be removed for safety or nuisance reasons.                                                               | Trees that may live for more than 15 years but would be removed for safety or nuisance reasons.                                                               | Dangerous trees through damage, structural defect, instability or recent toss of adjacent trees.                             | Young trees less than 15 years old but over 5m in height.              |
| <b>C</b> | Trees of special significance for historical, commemorative or rarity reasons that would warrant extraordinary efforts to secure their long term retention. | Trees that may live for more than 40 years but should be removed to prevent interference with more suitable individuals or to provide space for new planting. | Trees that may live for more than 15 years but should be removed to prevent interference with more suitable individuals or to provide space for new planting. | Dangerous trees through structural defects including cavities, decay, included bark, wounds or poor form.                    | Trees that have been regularly pruned to artificially control growth'. |
| <b>D</b> |                                                                                                                                                             | Trees that could be made suitable for retention in the medium term by remedial tree care.                                                                     | Trees that require substantial remedial tree care and are only suitable for retention in the short term.                                                      | Damaged trees that are clearly not safe to retain.                                                                           |                                                                        |
| <b>E</b> |                                                                                                                                                             |                                                                                                                                                               |                                                                                                                                                               | Trees that may live for more than 5 years but should be removed to prevent interference with more suitable individuals or to |                                                                        |

|          | 1 LONG SULE | 2 MEDIUM SULE | 3 SHORT SULE | 4 REMOVALS                                                                                       | 5 MOVED OR REPLACED |
|----------|-------------|---------------|--------------|--------------------------------------------------------------------------------------------------|---------------------|
|          |             |               |              | provide space for new planting.                                                                  |                     |
| <b>F</b> |             |               |              | Trees that are damaging or may cause damage to existing structures within 5 years.               |                     |
| <b>G</b> |             |               |              | Trees that will become dangerous after removal of other trees for the reasons given in A) to F). |                     |




## Appendix D: Tree Protection Guidelines

The following tree protection guidelines must be implemented during the construction period if no tree specific recommendations are detailed.

### Tree Protection Zone Establishment

Prior to the introduction of any machinery or materials onto the site, and before initiating any works such as bulk earthworks, fencing should be installed. Once in place, any alterations or removal of protective fencing must receive approval from the project arborist. Access to the TPZ must be restricted by securing it appropriately. The establishment and management of the Tree Protection Zone should adhere to the following guidelines:

- 1) Specify the trees within and around the subject allotment that are slated for preservation and protection during the development process. This could involve trees on neighboring properties as well as street trees.
- 2) The Tree Protection Zone radius should align with the calculation specified in the Individual Tree Data and Imagery.
- 3) Please locate and mark the alignment of protective fencing. This alignment may differ from the actual TPZ radius, taking into account areas where acceptable encroachment is permitted (determined in consultation with the project arborist) and site access needs. Protective fencing is necessary only within the subject allotment, assuming appropriate boundary fencing is already installed.
- 4) Set up protective fencing as depicted in the accompanying image. Adhere to the relevant fencing requirements outlined in AS 4687 for temporary fencing and hoardings. Additionally, affix shade cloth or a similar material to mitigate the transfer of dust, particulate matter, and liquids into the protected area.

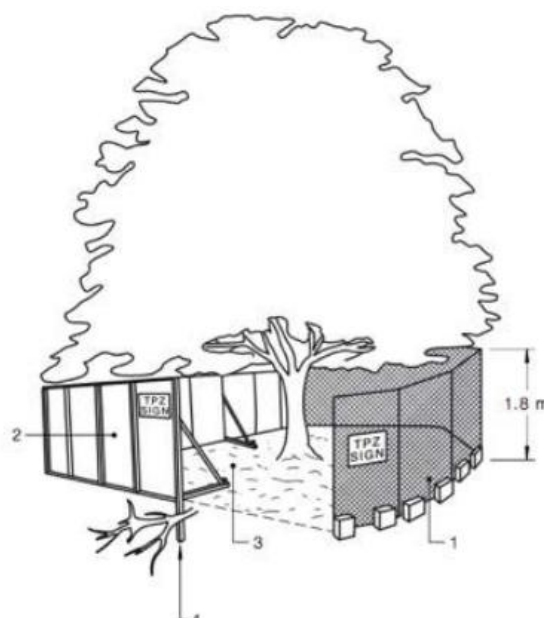

#### Legend:

1. Chain wire mesh panels with shade cloth (if required) attached, held in place with concrete feet.
2. Alternative plywood or wooden palling fence panels. This fencing material also prevents building materials or soil entering the TPZ.
3. Mulch installation across surface of TPZ (at the discretion of the Project Arborist). No excavation construction activity, grade changes, surface treatment or storage of materials of any kind is permitted within the TPZ.
4. Bracing is permissible within the TPZ. Installation of supports should avoid damaging roots.

### Protection when works within the tree protection zone is required


If the fencing has been reduced from the full TPZ radius to accommodate vehicle or machinery access, it's crucial to implement heavy-duty ground protection and trunk protection. This measure is essential to support the passage of vehicles like excavators, cranes, pier drilling machinery, hydro-excavation trucks, and other necessary equipment.

The heavy-duty ground protection includes:

- 1) A layer of geotextile fabric on top of the natural ground.
- 2) Cover the geotextile with a 100mm thick layer of organic mulch.
- 3) Install ground protection on top of the organic mulch (Bog mat or timber battens)

Trunk protection will include protection to the trunk and branches of trees as shown below. A minimum height of 2m is recommended.

- 1) Install breathable padding or hessian around the trunk of the tree.
- 2) Install closely spaced timber battens around the trunk, with the top edge protecting the trunk/bark by the padding/hessian. Secure with strapping

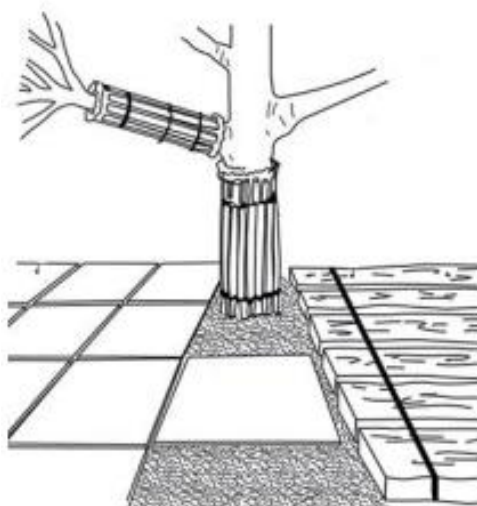


#### Notes:

1. For trunk and branch protection use boards and padding that will prevent damage to bark. Boards are to be strapped to trees, not nailed or screwed.
2. Rumble boards should be of a suitable thickness to prevent soil compaction and root damage.





### Underground Services

Whenever feasible, route all underground services away from the TPZ. If installing underground services within the TPZ becomes unavoidable, utilize non-intrusive methods such as horizontal directional drilling (HDD), non-destructive excavation (NDE) techniques like hydro-vacuum or Air Spade, or manually excavated trenches. Ensure that horizontal drilling or boring is carried out at a depth of at least 600 mm below grade. It's important to note that trenching for services is classified as "excavation." The project arborist should assess the potential impacts of drilling and bore pits on retained trees.

Example of a Tree Protection Sign

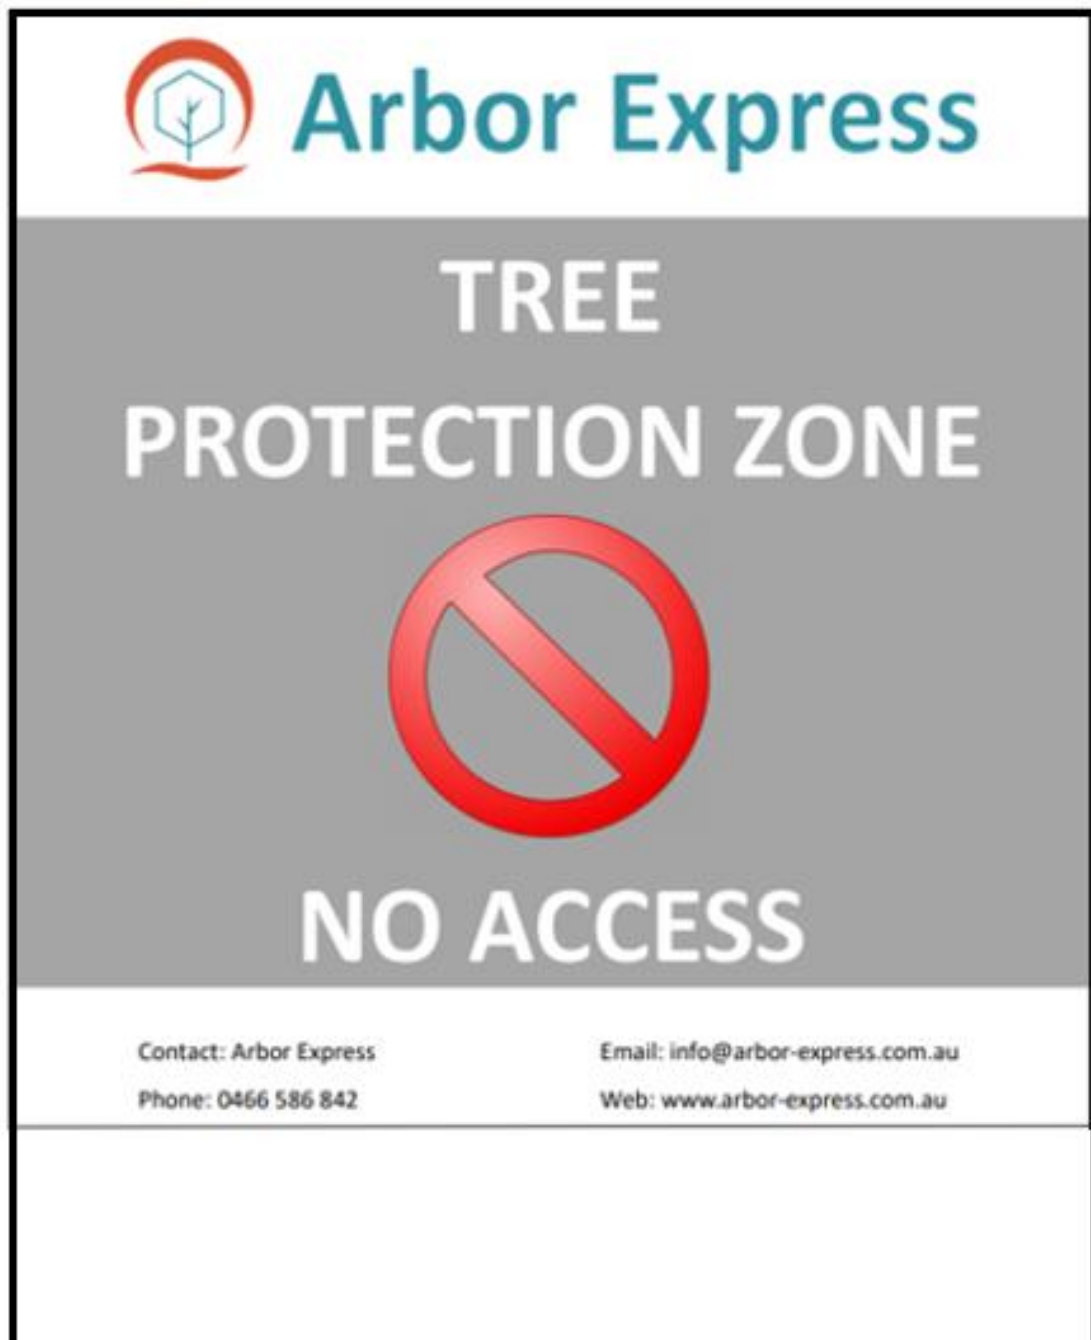

## Appendix E: Encroachment into the Tree Protection Zones

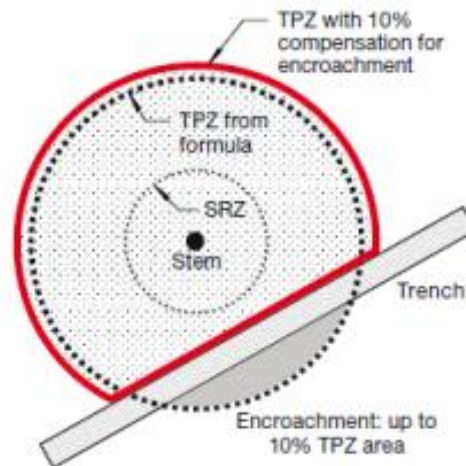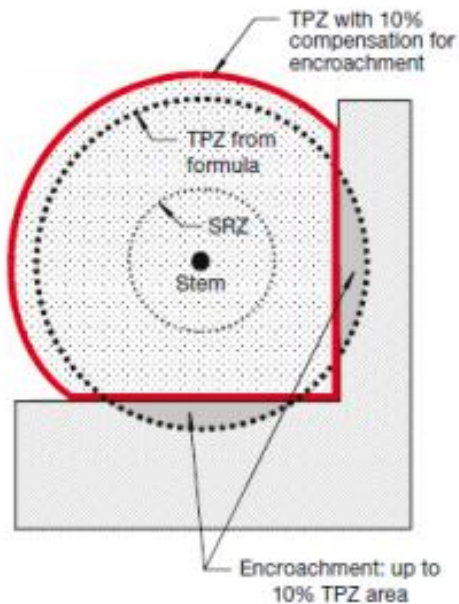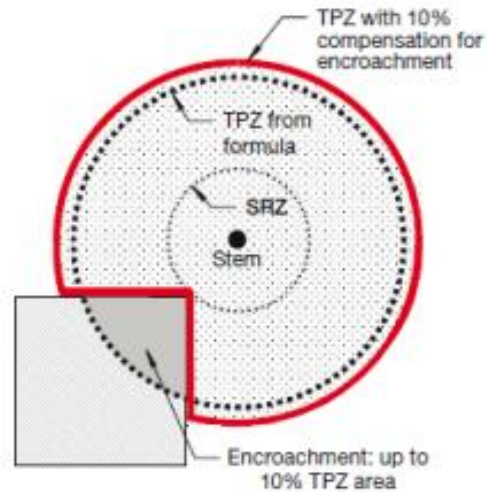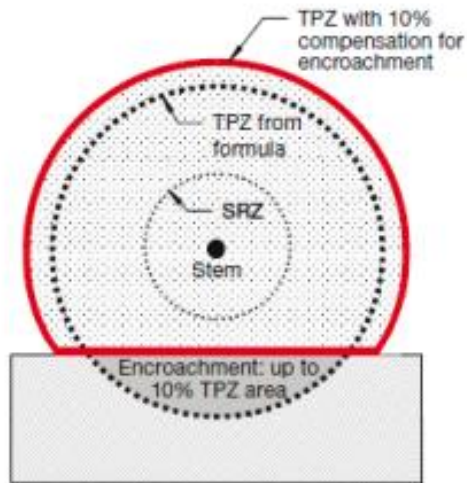





---

#### Locations

- Sydney
- NSW South Coast (Wollongong to Bega)
- NSW Central Coast (Gosford to Newcastle)
- Southern Highlands
- Blue Mountains
- Canberra and Queanbeyan
- Regional NSW

---

#### Services

- Arborist Reports for Developments
- Tree Root Mapping
- Project Arborist
- Tree Health and Safety Assessments
- Tree Structural Testing (Resistograph)
- Flora & Fauna Assessments and Project Ecologist
- Vegetation Management Plans

---

#### Contact Us

- 0466 586 842
- [Info@arbor-express.com.au](mailto:Info@arbor-express.com.au)