


Attachment F

**Inspection Report - 20-26
Bayswater Road, Potts Point**

20 - 26 Bayswater Road Potts Point

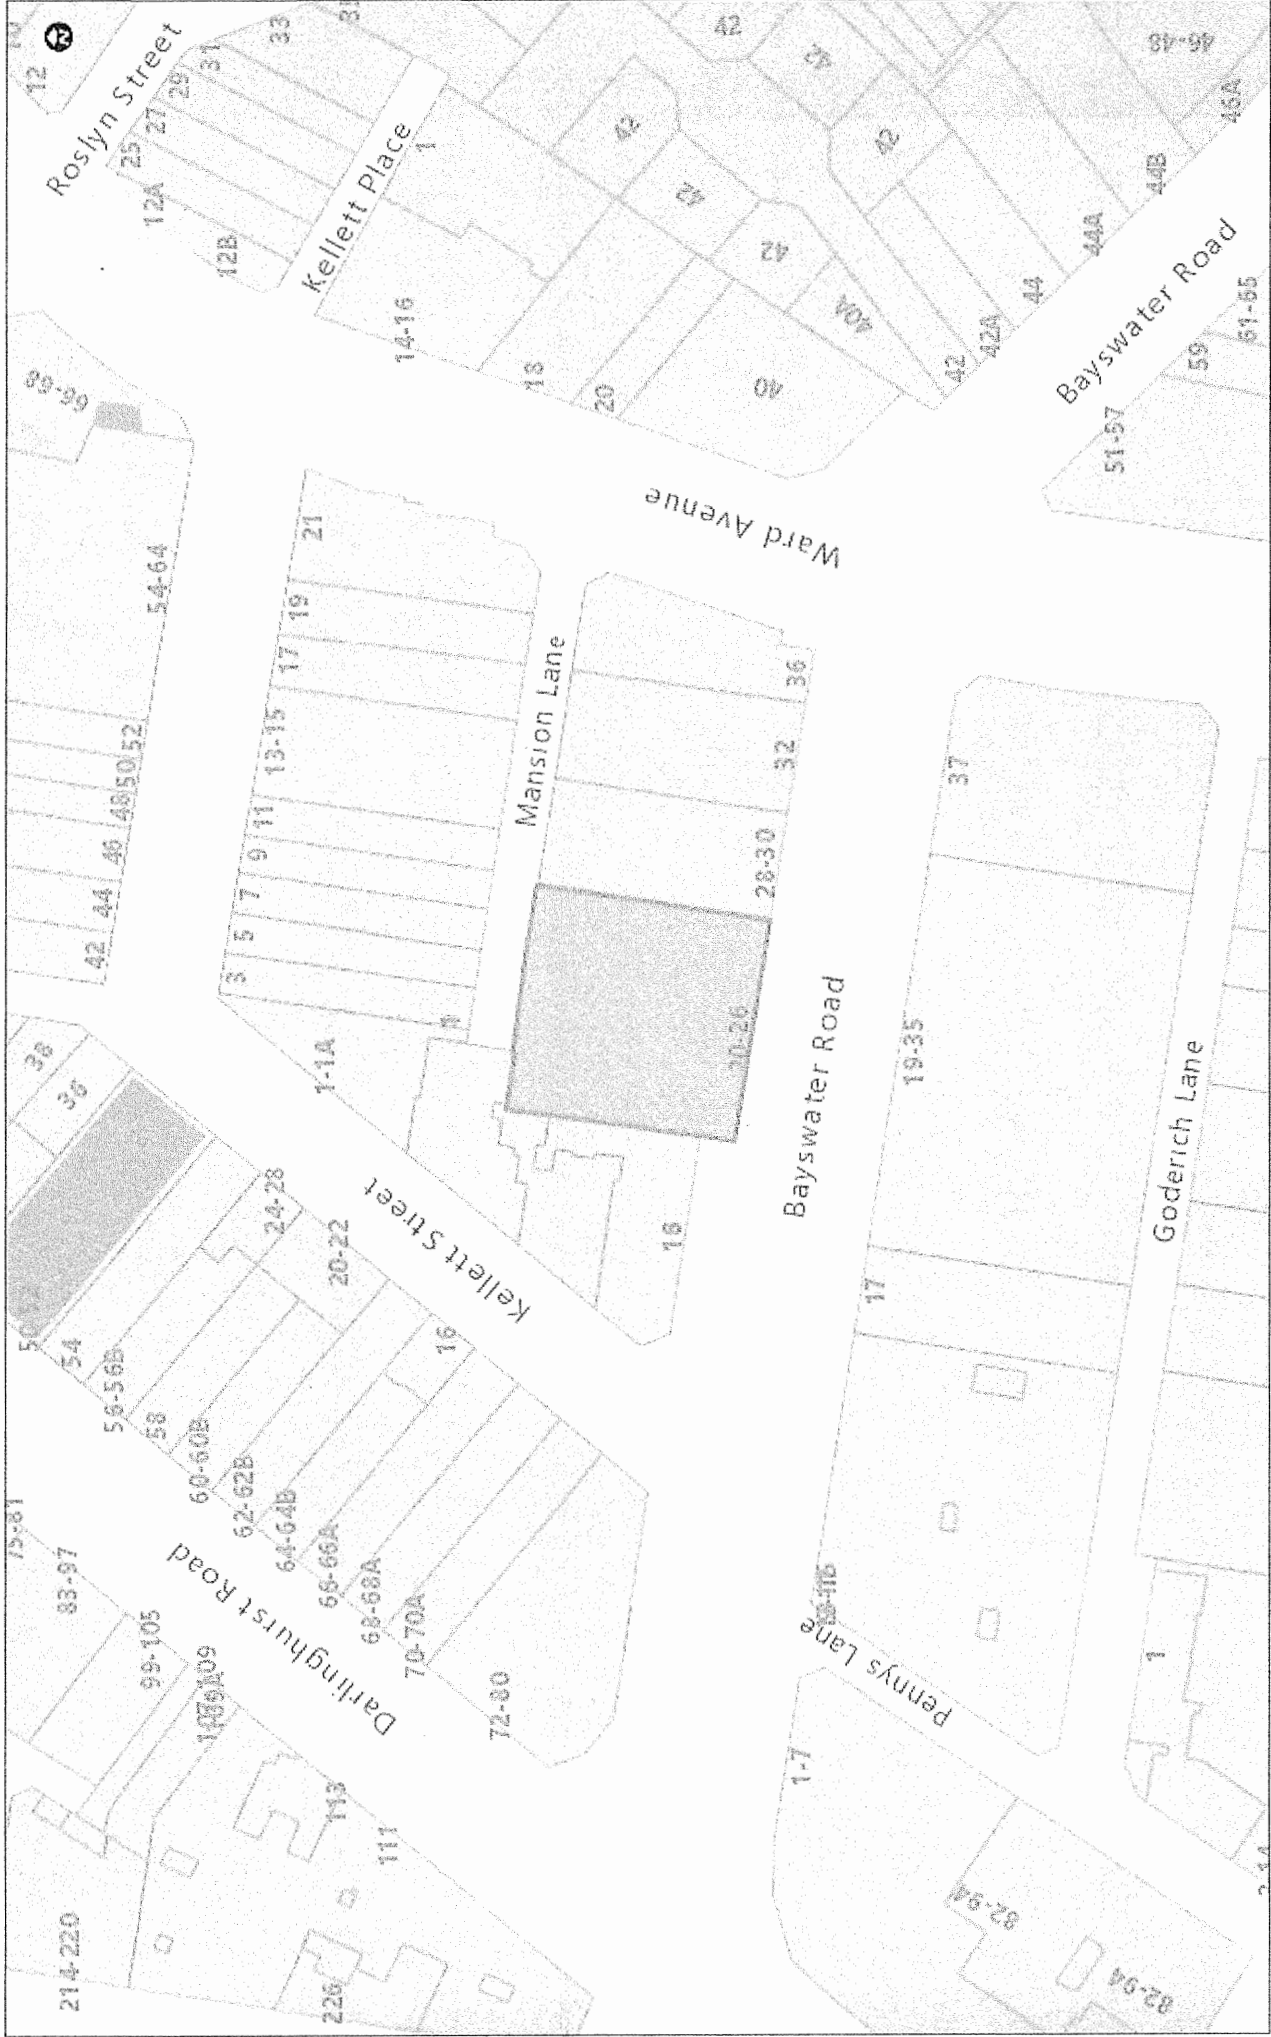

© City of Sydney Council 2018. All Rights Reserved. This map has been compiled from various sources and the publisher and/or contributors accept no responsibility for any injury, loss or damage arising from the use, error or omissions therein. While all care is taken to ensure a high degree of accuracy, users are invited to notify Council's Spatial Services of any map discrepancies. No part of this map may be reproduced without written permission.

Date 3-Jun-19
A4 1:1,000



city of sydney

**Council investigation officer Inspection and Recommendation Report
Clause 17(2) of Schedule 5, of the Environmental Planning and Assessment Act
1979 (the Act)**

File: CSM 2040007

Officer: Craig Hann

Date: 15 March 2019

Premises: 20 – 26 Bayswater Road, Potts Point – Candy’s Nightspot

Executive Summary:

Council received correspondence from the Commissioner of Fire and Rescue NSW (FRNSW) in relation to the subject premises with respect to matters of fire safety. The correspondence relates to that part of the premises known as Candy’s Nightspot.

The premises consist of a four interconnected terrace type buildings comprising of four storeys. The building is primarily used as nightclubs / bars, it also contains a gym and commercial office suites on the upper levels of the building.

The floor levels of the building are configured as follows:

- Basement level – Candy’s Nightspot nightclub.
- Ground floor level – Gym, Cali Club and an entrance foyer to the upper level commercial office suites.
- First floor level – Cali Club and commercial office suites.
- Second floor level – Cali Club and commercial office suites.

An inspection of the premises undertaken by a Council investigation officer in the presence of the manager revealed that there were no significant fire safety issues occurring within the premises.

The premises are equipped with numerous fire safety systems (both active and passive) that would provide adequate provision for fire safety for occupants in the event of a fire. The annual fire safety certification is current and compliant and is on display within the building in accordance with the requirements of the Environmental Planning and Assessment Regulation 2000.

Observation of the external features of the building did not identify the existence of metal composite cladding.

Chronology:

| Date | Event |
|-------------|---|
| 18/2/2019 | FRNSW correspondence received regarding premises Candy’s Nightspot, 22 Bayswater Road Potts Point. The premises is part of a building known by council as 20 – 26 Bayswater Road Potts Point. |
| 13/3/2019 | An inspection of the subject premises undertaken by a Council officer revealed that there were no significant fire safety issues occurring within the premises. The inspection also revealed the corrective action works to exit signage required by Council’s resolution at their meeting held on 11 March 2019 (attachment C-Fire Safety Report) has been complied with. |

FIRE AND RESCUE NSW REPORT:

References: [BFS19/464, D19/10081; 2019/082981]

Fire and Rescue NSW conducted an inspection of the subject premises on 19 January 2019 as part of a joint inspection with officers from NSW Police Force.

Issues

The report from FRNSW advises there were no items of concern at the time of their inspection.

FRNSW Recommendations

FRNSW have made no direct recommendation within their report other than legislative notification.

COUNCIL INVESTIGATION OFFICER RECOMMENDATIONS:

| Issue Order(NOI) | Issue emergency Order | Issue a compliance letter of instruction | Cited Matters rectified | Continue to undertake compliance action in response to issued Council correspondence | Continue with compliance actions under the current Council Order | Note the inspection by FRNSW |
|------------------|-----------------------|--|-------------------------|--|--|------------------------------|
| | | | | | | |

It is recommended that Council not exercise its powers to give a fire safety order at this time.

That the Commissioner of FRNSW be advised of Council's actions and determination.

Referenced documents:

| No# | Document type | Trim reference |
|-----|--|----------------|
| A1. | Fire and Rescue NSW report | 2019/104557 |
| A2. | Locality Plan | 2019/002806-01 |
| A3. | Attachment cover sheet | 2019/104557-01 |
| A4. | Council Officer Inspection and Recommendation Report dated 24 January 2019 | 2019/002806 |

Trim Reference: 2018/104557

CSM reference No#: 2040007



File Ref. No: BFS19/464 (6366)
TRIM Ref. No: D19/10081
Contact: [REDACTED]

15 February 2019

General Manager
City of Sydney
GPO Box 1591
SYDNEY NSW 2001

Email: council@cityofsydney.nsw.gov.au

Attention: Manager Compliance/Fire Safety

Dear Sir / Madam

**Re: INSPECTION REPORT
"CANDY'S NIGHTSPOT"
22 BAYSWATER ROAD, POTTS POINT ("the premises")**

Pursuant to the provisions of Section 9.32(1) of the *Environmental Planning and Assessment Act 1979* (EP&A Act), an inspection of 'the premises' on 19 January 2019 was conducted by Authorised Fire Officers from the Fire Safety Compliance Unit of Fire and Rescue NSW (FRNSW). The inspection was also conducted in the company of Officers from the NSW Police Force.

The inspection was limited to the following:

- A visual inspection of the essential Fire Safety Measures as identified in this report only.
- A conceptual overview of the building, where an inspection had been conducted without copies of the development consent or copies of the approved floor plans.

Please be advised that details of this inspection have been provided in accordance with Section 9.32(4) of the EP&A Act. Therefore, on behalf of the Commissioner of FRNSW, the following comments are provided for your information in accordance with Schedule 5, Part 8, Section 17(1)(a) of the EP&A Act.

COMMENTS

There were no items of concern found at the time of the inspection.

Should you have any enquiries regarding any of the above matters, please do not hesitate to contact [REDACTED] of FRNSW's Fire Safety Compliance Unit on (02) 9742 7434. Please ensure that you refer to file reference BFS19/464 (6366) for any future correspondence in relation to this matter.

Yours faithfully

[REDACTED]

[REDACTED]
Senior Building Surveyor
Fire Safety Compliance Unit

**Council investigation officer Inspection and Recommendation Report
Clause 17(2) of Schedule 5, of the Environmental Planning and Assessment Act
1979 (the Act)**

File: CSM 2003504

Officer: Craig Hann

Date: 24 January 2019

Premises: 20 – 26 Bayswater Road Potts Point – Candy’s Nightspot

Executive Summary:

Council received correspondence from the Commissioner of Fire and Rescue NSW (FRNSW) in relation to the subject premises with respect to matters of fire safety. The correspondence relates to that part of the premises known as Candy’s Nightspot.

The premises consist of a four interconnected terrace type buildings comprising of four storeys. The building is primarily used as nightclubs / bars, it also contains a gym and commercial office suites on the upper levels of the building.

The floor levels of the building are configured as follows:

- Basement level – Candy’s Nightspot nightclub.
- Ground floor level – Gym, Cali Club (formerly The World Bar) and an entrance foyer to the upper level commercial office suites.
- First floor level – Cali Club (formerly The World Bar) and commercial office suites.
- Second floor level – Cali club (formerly The World Bar) and commercial office suites.

An inspection of the premises undertaken by a Council investigation officer in the presence of the building’s managing real estate agent and tenant revealed that there were no significant fire safety issues occurring within the building.

The premises are equipped with numerous fire safety systems (both active and passive) that would provide adequate provision for fire safety for occupants in the event of a fire. The annual fire safety certification is current and compliant and is on display within the building in accordance with the requirements of the Environmental Planning and Assessment Regulation 2000.

Council investigations have revealed that whilst there remains several minor fire safety “maintenance and management” works to attend to, such as additional exit sign installations, the overall fire safety systems provided within the subject premises are considered adequate in the circumstances.

It is considered that the above fire safety works are of a degree which can be addressed by routine preventative and corrective maintenance actions undertaken by the owner’s fire service contractor(s) through written instruction from Council.

Observation of the external features of the building did not identify the existence of metal composite cladding.

Chronology:

| Date | Event |
|-------------|---|
| 18/12/2018 | FRNSW correspondence received regarding premises Candy’s Nightspot, 22 Bayswater Road Potts Point. The premises is part of a building known by council as 20 – 26 Bayswater Road Potts Point. |
| 17/1/2019 | An inspection of the subject premises was undertaken by a Council officer together with the managing real estate agent and tenant. |

The inspection revealed:

Some areas of the premises do not have a clear view of the existing exit sign installations. Additional exit signs are required to clearly identify all exit ways.

There were no decorative light fittings, disco balls or the like hanging from the sprinkler pipework above the dance floor.

Rear exit passageway is a path of travel to an exit that discharges to Mansion Lane at the rear. It is an internal part of the premises available for use by customers, it is located off to the side of the main body of the premises. There are no 'built in' fixtures, such as seating or bars, to cause an obstruction to the exit. Any persons gathered in this area could move freely towards the exit if required.

The management office doorway height is localised to a single doorway in a staff area. The doorway is fitted within an archway structure of the heritage listed building and it is not readily altered. The staff occupants are considered to be familiar with the existing doorway height provided. Therefore it's considered the height will not unduly interfere with exit functionality.

The stage has access to two (2) alternate exits. Therefore, the exit travel distance are permitted to be 40 metres to one (1) of the exits. The travel distances from the stage area to an exit comply with the building regulations.

FIRE AND RESCUE NSW REPORT:

References: [BFS17/3051, D17/87175; 2018/645968]

Fire and Rescue NSW conducted an inspection of the subject premises on 9 December 2017 as part of a joint inspection with officers from NSW Police Force and City of Sydney Council.

Issues The report from FRNSW detailed a number of issues, in particular noting:

1. Adequacy of the locations of Exit sign installations to identify the exits;
2. Possible obstruction of sprinkler water spray by decorations attached to sprinkler system pipework;
3. Adequacy of exits – obstruction, doorway height and travel distance.

FRNSW Recommendations

FRNSW have recommended that Council inspect the subject premises and appropriately address noted (and other) deficiencies identified within their report.

FRNSW have also referred the matter to Council as the appropriate regulatory authority. They await Council's advice of the determination in respect of the recommendations in accordance with clause 17(4) of Schedule 5 of the Environmental Planning and Assessment Act 1979.

COUNCIL INVESTIGATION OFFICER RECOMMENDATIONS:

| Issue Order(NOI) | Issue emergency Order | Issue a compliance letter of instruction | Cited Matters rectified | Continue to undertake compliance action in response to issued Council correspondence | Continue with compliance actions under the current Council Order | Other (to specify) |
|------------------|-----------------------|--|-------------------------|--|--|--------------------|
|------------------|-----------------------|--|-------------------------|--|--|--------------------|

As a result of site inspections undertaken by Council investigation officers it was determined that the owners of the building be issued with written instructions to rectify the identified fire safety deficiencies noted by Council.

The above written instructions will direct the owners of the premises to carry out remedial actions to existing fire systems to cause compliance with required standards of performance.

Follow-up compliance inspections will be undertaken by a Council officer to ensure all identified fire safety matters are suitably addressed and that compliance with the terms of Councils correspondence is achieved.

It is recommended that Council not exercise its powers to give a fire safety order at this time.

That the Commissioner of FRNSW be advised of Council's actions and determination.

Referenced documents:

| No# | Document type | Trim reference |
|-----|----------------------------|----------------|
| A1. | Fire and Rescue NSW report | 2018/645968 |
| A2. | Locality Plan | 2019/002806-01 |
| A3 | Attachment cover sheet | 2019/002806-02 |

Trim Reference: 2019/002806**CSM reference No#:** 2003504
