2015-08-18



Martin Place urban design study



CONTENTS

Introduction

Purpose of the document	page 03
Martin Place in the past	page 04
Martin Place today	page 06
Public Life Data	page 08
Martin Place tomorrow	page 12
Main Potentials	page 14
Main Challenges	page 15
Objectives	page 16
Spatial Concept	page 18
Guidelines	page 19
Usage concept	page 20

page 22

Conceptual Approach

Analysis & Strategy

Underground & Train entries	page 24
Floor & Topography	page 26
Crossings	page 30
Built Edge	page 32
Landscape	page 34
Kiosks	page 36
Lighting	page 38
Public Seating	page 40
Outdoor Dining & cafés	page 46
Fountains	page 50
Memorials	page 54
Martin Place as event space	page 56
Detailed Plans	page 61
Phasing	page 67



Gehl Architects Vesterbrogade 24, 5th floor 1620 Copenhagen V Denmark

www.gehlarchitects.com mail@gehlarchitects.dk

Tel +45 32 950 951 CVR no: 25 30 95 29

PURPOSE OF THIS DOCUMENT

Martin Place last saw an upgrade in 2000 in connection with the Olympic Games. This upgrade focused on renewing the paving and public benches in order to align the space with the general public space upgrades in connection with works installed prior to the Olympics throughout the CBD.

Since 2000 numerous projects have evolved in the CBD such as laneway upgrades, the public art program, more residences, and the upcoming George Street transformation project, which will reinstate light rail in George Street, as well as re-establish George Street as the main spine of the CBD. A 1 km stretch of George Street will be pedestrianised including the section that runs past Martin Place.

Martin Place presently has a number of redevelopment sites e.g. the MLC Centre, 20 Martin Place, and 60 Martin Place. The general feeling is that the public space looks tired and is in need of a refresh to bring life back into Martin Place, thereby restoring it as a preferred location in the city. Proposed elements (such as outdoor dining and playful fountains) aim to encourage activation of the public space.

This document is an evaluation and discussion of the various elements that will populate and activate Martin Place in an attempt to develop an informed basis for a future design proposal.

Martin Place in the past

FROM LANEWAY TO CIVIC HEART

Martin Place is a street built in phases and has changed several times during the 1900's to become what it is today. Until the late 1800's the section between Pitt and Castlereagh Street was called Moore Street and was connected to George Street via "St Martins Lane".

The General Post Office was similarly constructed in stages, starting in 1863. Since then it has undergone some changes including its iconic tower being removed in the 1940s, only to be reinstalled in the 1960s. Construction of the GPO concluded at the beginning of the 1890's and in 1892 St Martins Lane was widened and renamed Martin Place. The GPO had a telegraph office attached to it which meant that Martin Place quickly became an important place where news arrived first. Martin Place also became an key centre for business and finance, and remains so today.

The Cenotaph was built in 1927 to commemorate WW1, and commemoration gatherings continue as a significant activity for the space, especially on west Martin Place.

In 1935 extensions to Martin Place were completed all the way to Macquarie Street. As a result, the street became a connection between George Street (the high street) and Macquarie Street (the ceremonial and governmental axis). The street's importance as the civic heart of Sydney grew and during the 1970's the street was pedestrianised. Once the pedestrianisation process was completed, Martin Place Railway Station opened in 1979.

Since then, there has been a clear change in the way we design and use public space. In the past, public space was dominated by representative design and is now performance based. Today, the focus of public space is to provide a framework for public life, rather than a host for various objects. Today spaces are shaped instead of being designed around the objects populating them.


Source: Wikipedia; City of Sydney & Webber 'The Design of Sydney' 1988



Everyday scenery on Martin Place in the 1950's. *Source: City of Sydney Archive*



Anzac Parade in Martin Place, 1930. Source: http://hdimagegallery.net/anzac+day+march

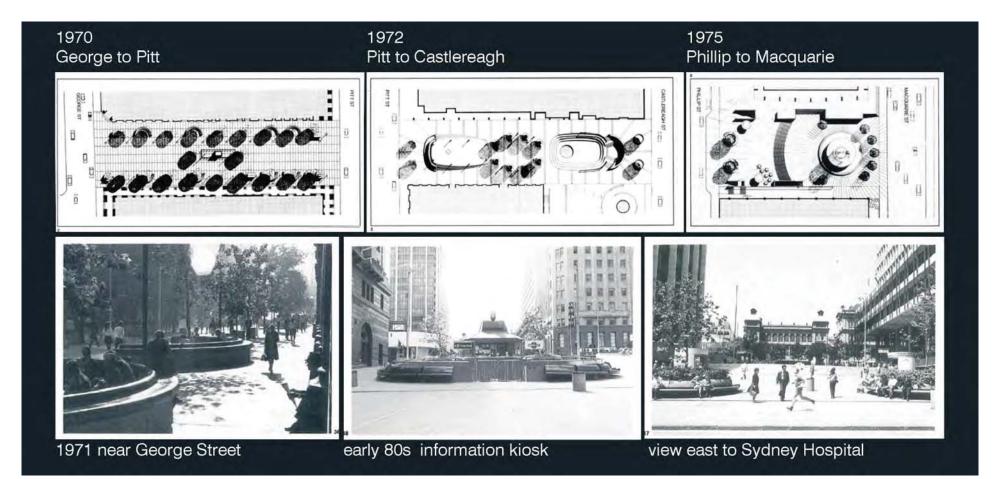


For various reasons the atmosphere from the 1970's pedestrianisation remains in Martin Place despite alterations to the paving and other urban elements over the years. *Source: "The Design of Sydney", Webber, 1988*

Martin place today


Martin Place is one of many public spaces in Sydney's CBD. However Martin Place holds a significant importance as one of the few urban spaces that holds bigger events and has one of the most central locations.

The following characteristics are defining Martin Place today:


- FORMAL
- EVENT SPACE
- THOROUGHFARE
- PUBLIC TRANSPORT NODE
- FINANCIAL DISTRICT
- HIGH LEVEL BRANDS
- CEREMONIAL
- LUNCHTIME PLAZA
- **RESPITE**

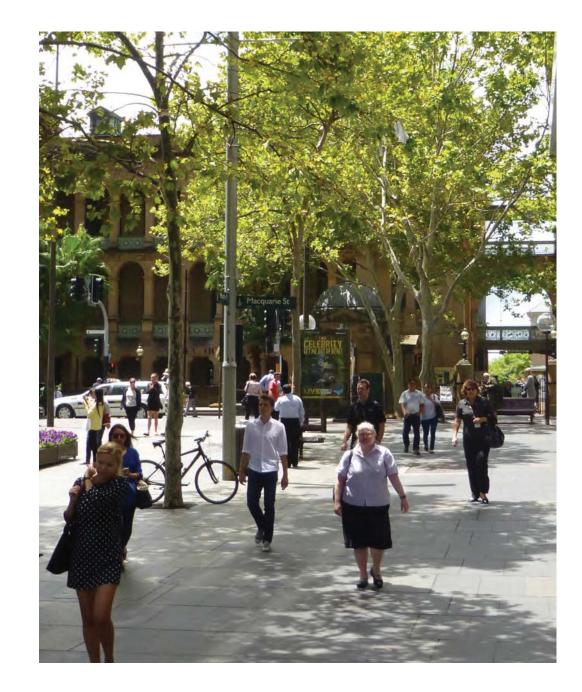




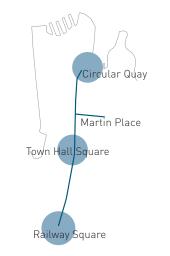


George Street is the spine of the CBD, with three main spaces -Circular Quay, Town Hall Square, and Railway Square.

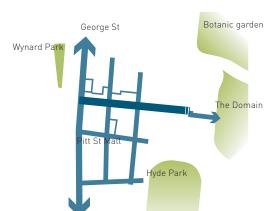

Martin Place is well connected to numerous key destinations in the CBD.

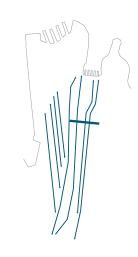

The CBD is dominated by northsouth axis streets. Martin Place is an exception and provides an opportunity to experience the city on an east-west axis.

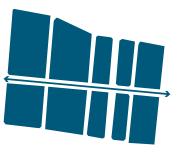

The CBD is dominated by rectangular blocks with long north-south facades and narrow east-west facades. Martin Place is populated by shorter blocks, which provide more variation in building frontages, but also more intersecting streets.

Martin Place today - Public Life Data

PEDESTRIAN TRAFFIC IN 2012


Weekdays are dominated by a morning, lunchtime and evening peak, highlighting office workers in the area as the primary users.

Weekends see very little activity in Martin Place with a slight peak around lunchtime. Weekend visitors do not spend much time in Martin Place and do not perceive Martin Place as a key destination.


MOST BUSY AT PEAK HOUR & LUNCHTIME


George St - Pitt St

Pitt St - Castlereagh St

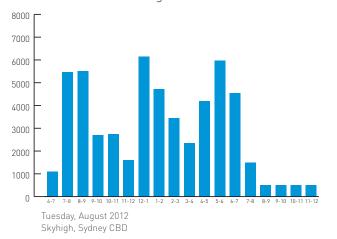

NOT A WEEKEND DESTINATION

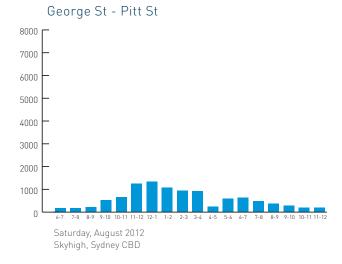

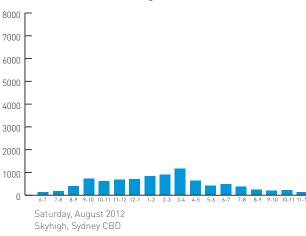



Pitt St - Castlereagh St

STATIONARY ACTIVITY REGISTRATIONS IN 2007

As part of the Public Spaces and Public Life study in 2007 registrations of recreational activities were undertaken. Activities may include people who stop walking to rest on a bench, people who stop to engage in a conversation, people sitting at an outdoor café, or people smoking outside offices.

These types of activities indicate the general usage or lack of usage of a public space, and tend to happen when the urban quality is right and the weather is good.

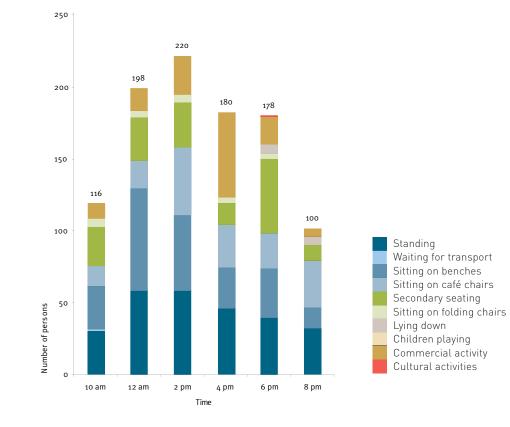

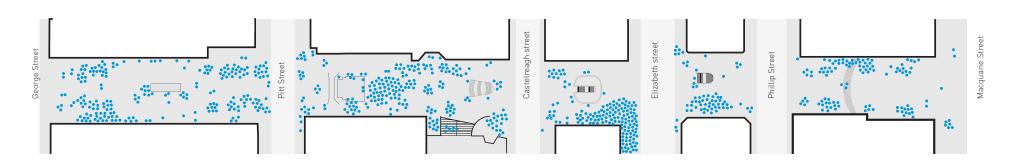


STATIONARY ACTIVITY USE PATTERN DURING A SUMMER WEEKDAY Scale 1 :2000 (Accumulation of 6 recordings carried out on a summer weekday between 10am and 8pm)


Martin Place today - Microclimate

AT 2 PM IN JUNE ALL OF MARTIN **PLACE IS** SHADED

SUNNY MOST OF THE DAY IN SUMMER **2 PM IN DECEMBER**



SUNNY PATCHES ALONG THE SOUTHERN FACADES IN SPRING AND AUTUMN **2 PM IN MARCH**





Generally people favour the steps in the sun for the majority of the

Steps in the sun are more appealing than benches in the shade.

Opposite page: The steps at the GPO are a favorite place for lingering and enjoying the sun.

year.




Martin Place tomorrow



Martin Place in the 1950s Source: https://www.historypin.org/ channels/view/30932/#!photos/list/

FUTURE AND ONGOING PROJECTS IN MARTIN PLACE

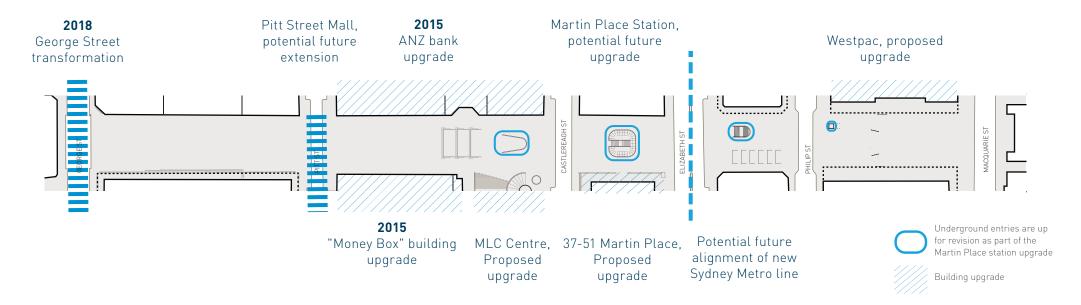

The illustration above indicates future changes in and around Martin Place.

A number of redevelopments are occurring in Martin Place in the nearby future, as well as the George Street transformation project.

The upgrade of Martin Place Station is also scheduled, however the exact timing is unknown.

Main Potentials

CITY RECITAL HALL

- Central; in the retail core of the CBD
- Accessible; many points of entry
- **Connected**; a pedestrian link connecting transport modes

EMPORIO 7 RMANI


- **Destination**; Sydney's gathering space
- **Topography**; interesting views and experience
- **History**; heritage buildings of fine quality
- Quiet pockets; no vehicular access east-west
- Change is in the air; new developments are on the way
- Good access to sunny spaces

(as opposed to most locations in Sydney CBD)

Main Challenges

- Underwhelming
- Dimensions; long and narrow
- **Divided**; a sequence of spaces divided by vehicular streets
- Formal; memorial space, formal architecture
- Mono functional; primarily banks and offices, less retail
- Heritage; limited adaptation of heritage buildings
- In-active; deserted outside office hours, inactive frontages
- Urban corridor; people tend not to spend time
- Cluttered; numerous un-coordinated street elements
- Accessibility; steps and ramps
- Event space; a busy event schedule of mixed quality events
- Quality varies; quality difference from west to east

Martin Place objectives*

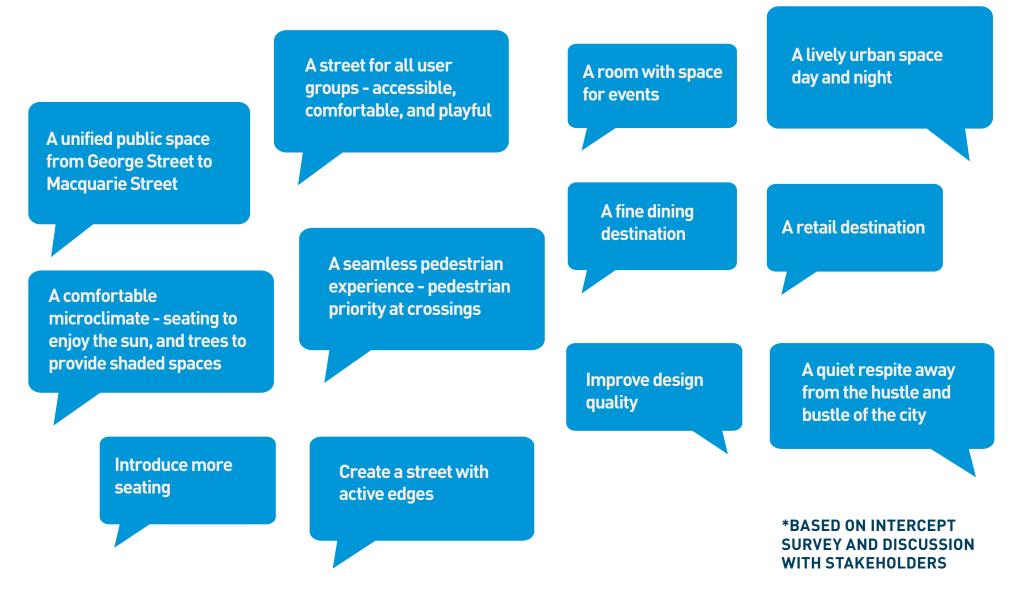

A PEOPLE PLACE

ABUNDANCE OF SEATING

A GREAT SPACE FOR DINING

AN EVENT SPACE





BEAUTIFUL LIGHTING

LUSCIOUS GREEN





INSPIRING WATER & ART




GREAT PAVING THROUGHOUT




Spatial concept


FROM A SEQUENCE OF SPACES ...




... TO A UNIFIED SPACE




FROM STREETS SEPARATING MARTIN PLACE ...

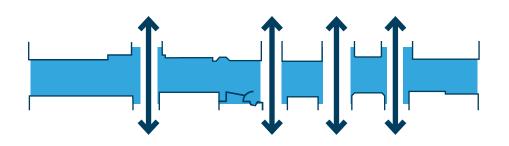


... TO STREETS ARRIVING AT A SQUARE

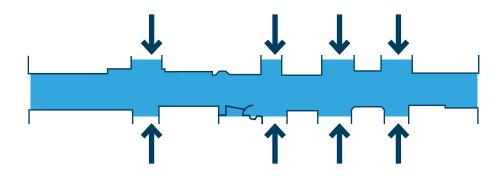

Guidelines

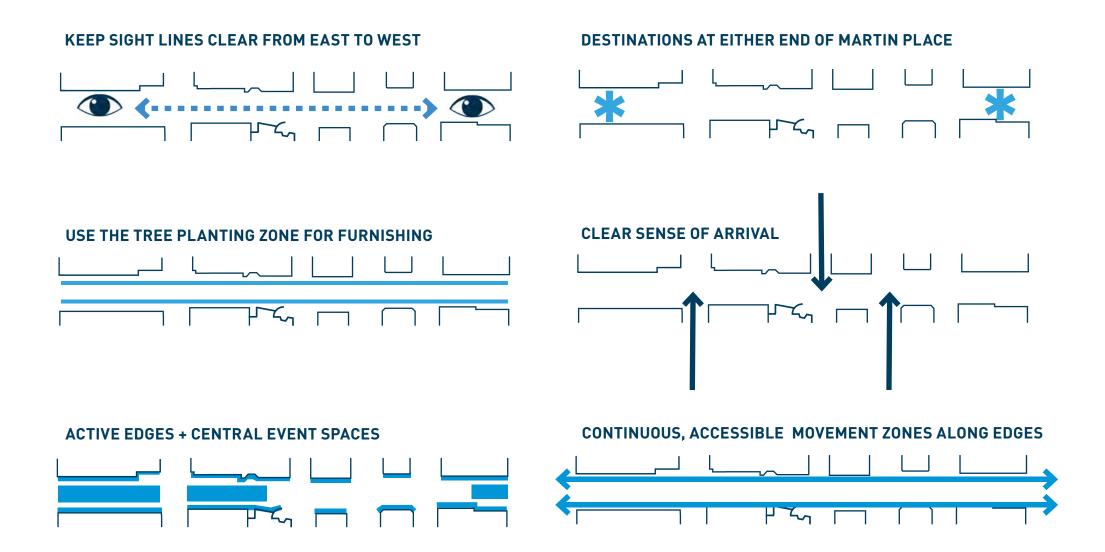

Usage concept



ITALIAN PIAZZA

- Classical
- Formal
- Inviting
- Spacious
- Warm
- Outdoor dining
- Tranquility

WATER PLAY

- Informal seating
- Friendly
- Engaging
- Short stops
- Meeting place
- Children
- Play
- Well connected to retail core

• EVENTS

• EVENTS

QUIET ZONE QUIET ZONE

- Access to public transport (short term)
- Respite
- Watching the daily street ballet
- Coffee spot
- Newspapers
- Reading room

CIVIC ZONE

- Great views
- Spectacular stairs/ ramps
- Water
- Green
- Fun and play
- Temporary interventions
- Public art
- Showroom
- EVENTS




Conceptual approach



LIFE a thoroughfare AND a recreational place



SPACE a green and attractive experience

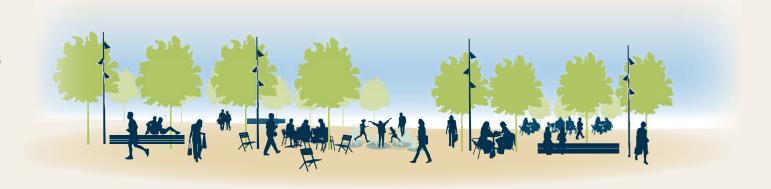

BUILDINGS active and inviting built edges



Underground & train entries

.

entry/exit

EXISTING CONDITIONS

9,000 II

- Substantial underground system beneath Martin Place.
- Station located at the far east end.
- Irrational movement to go up and down to access and exit the station.
- Entries take up space and create inflexible usage at ground level.

retail

- Activity is drawn away from Martin Place.
- Safety issues at night around entries.
- Martin Place Station is up for future redevelopment.



Q1_19

EAST -Weekday ---- Sat ----- Sun 30,000 25.000 entries / exits 20,000 15.000 assenger 10,000 5,000 0 8 21:00 3:00 8 0:0 2:00 3:00 8:00 9:00 8 8 1:00

station entry/exit

Passenger flow in /out of Martin Place station

24



entry/exit

retail

entry/exit

Entrance to underground shopping/dining area.


Endless steps to exit Martin Place station. Federal Reserve Bank

WEST

PROPOSAL

- Opportunities for better integration of station infrastructure and reduced
 impact on surface level can be achieved with the development of the
 Martin Place metro station and associated redevelopment of Martin
 Place train station.
- Elizabeth Street could be a a preferred public transport hub because of its extra width which can accomodate light rail in the future as well as access to Martin Place station.
- All station entries to be reintegrated within development. Entry portals at surface within Martin Place to be minimised.
- Access to underground retail via new station entries.

- Underground retail can be minimized to allow for more trees and activity at ground level.
- By removing the western entrance more space is gained in front of the popular MLC stairs. This space has great development potential as the north facades could be activated.
- The staircase to the underground (Castlereagh /Elizabeth) gives access to underground retail that has been leased by council to a private operator for the next 23 years. The staircase to the underground retail can be minimized or potentially relocated.

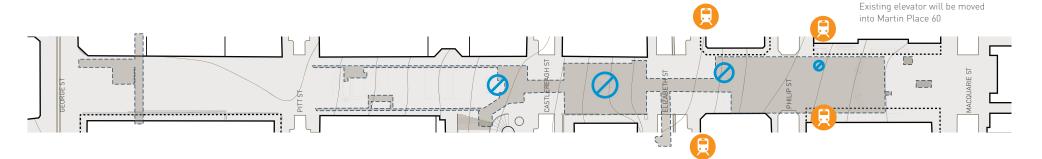




Entry to Martin Place train station could be relocated to building frontages. The entry to the underground retail could be minimized or potentially relocated. Wynard Station, Sydney

Floor & topography

EXISTING CONDITIONS

- Substantial topographical change from west to east. •
- Western plaza contains the most even surface. •
- Eastern plaza has future potential for increased usage in terms of its ٠ even surface at the upper level.
- The current fountain occupies a large area that is relatively flat. ٠
- Visual continuity of Martin Place is interrupted by the bitumen surface of ٠ the many cross streets.



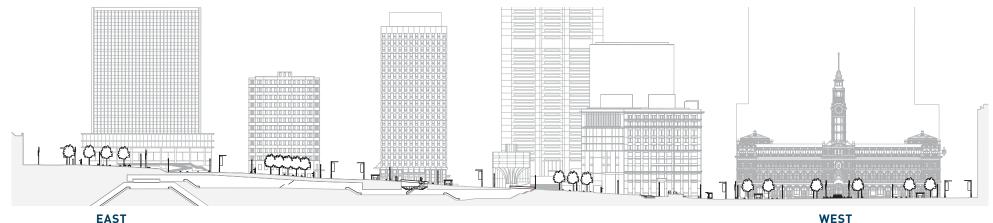

EAST



The topography of Martin Place is not only a challenge it also provides some wonderful views to the hospital at Macquarie Street or George Street at the other end.

The area behind the fountain is shaped as long atrium steps providing views and a place for resting.



PROPOSAL


- Maintain current paving but replace broken tiles etc.
- Clean up of existing paving.
- Continuous paving across intersecting streets.
- Re-work large fountain to be more interactive.
- Extend paving and steps in central area after removal of underground entries (long term).
- Explore public art opportunities in paving or in interpreting topography.
- Maximise even surfaces for events and seating/dining opportunities.



Broadway dancesteps by artist Jack Mackie



Henrik Ibsen writings Karl Johan, Oslo

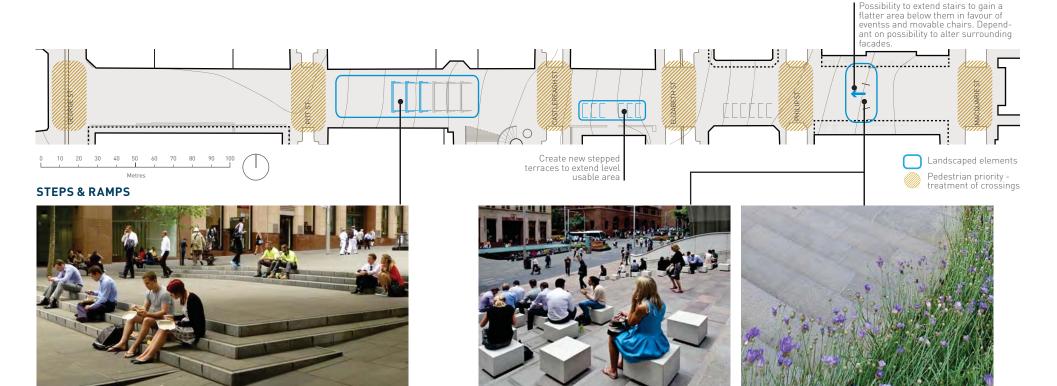

Create three more plateaus. Extension of the existing landscape - this will create more secondary seating on the steps. The idea is also to increase the flat surface were small events can take place or movable furniture can be placed.

Activation in form of seating cubes of the popular stairs by the MLC center.

Gehl Architects — Urban Quality Consultants 27

Introduce planting as playful elements in the stairs for a

softer impression and a different sensory experience

PUBLIC ART

Before

Telephone

TITLE

martin place shopping circle

NPS

GeBIT

GLOBA

(BI)

CÍ

EX

E





Crossings EXISTING CONDITIONS

- Martin Place is divided into 5 separate sections by crossing traffic. At every crossing street there is a signalled pedestrian crossing.
- Lack of pedestrian priority.
- Clutter related to crossings.

Metres

- Waiting time.
- Martin Place is not experienced as one grand place.
- Relatively few accidents

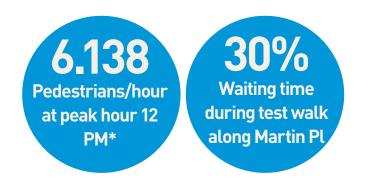

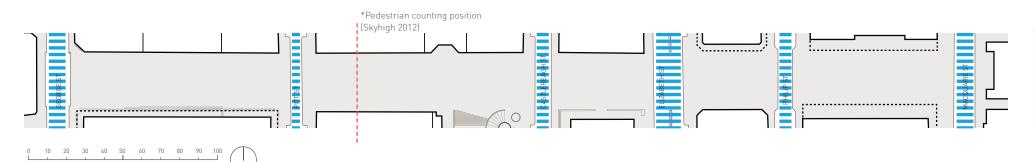




across George Street. Hassell 2013


Martin Place is continuously dissected by crossing traffic. Pitt Street

Pedestrian accidents on Martin Place by cross street in 2009-13

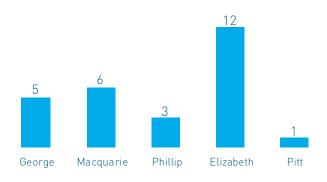

PROPOSAL

- Introduce temporary public art as a short term measure to create a sense of character.
- Enhance pedestrian priority by increasing crossing time and decreasing waiting time.
- Long term unify Martin Place via continuous, consistent paving type.
- Aim to remove signalled crossings and introduce pedestrian priority along Martin Place by incorporating paving to crossing zones.
- Aim for level crossings at all intersections
- No bollards



LONG TERM



Unified paving to the entire crossing zone, which should be differentiated from pavement areas. Oxford Circus, London

The crossing zone is a mix of different types of pavers, but all of the same material and colour. Malmö, Sweden


Gehl Architects — Urban Quality Consultants

31

San Francisco, USA

Built edge **EXISTING CONDITIONS**

- Large scale formal buildings lacking interaction with the place. •
- Heritage buildings with limited possibilities for adaptation to other uses. ٠
- Set back frontages, large lobbies etc. ٠
- Materiality. Many fine sandstone buildings, but also slick granite facades. •
- The functions of the numerous banks located on the street limit the potential to open up building facades to the place.

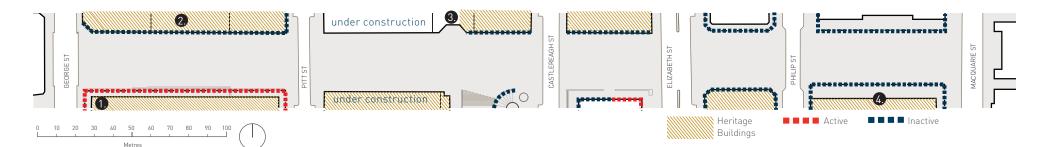



Unique heritage buildings. GPO

Inactive facade of heritage building.


Inactive frontage and problematic setback. United Overseas Bank Singapore

Problematic interface between building and square. Reserve Bank of Australia

Paspaley

PROPOSAL

- Where possible, convert ground floor frontages to cater for retail and restaurants.
- Develop guidelines and ideas for heritage buildings.
- Encourage new developments to provide active ground floors with public functions.
- Provide assessments with building owners regarding what is possible.
- Encourage precinct-wide thinking rather than a piece by piece approach to ensure coherence and character in Martin Place.

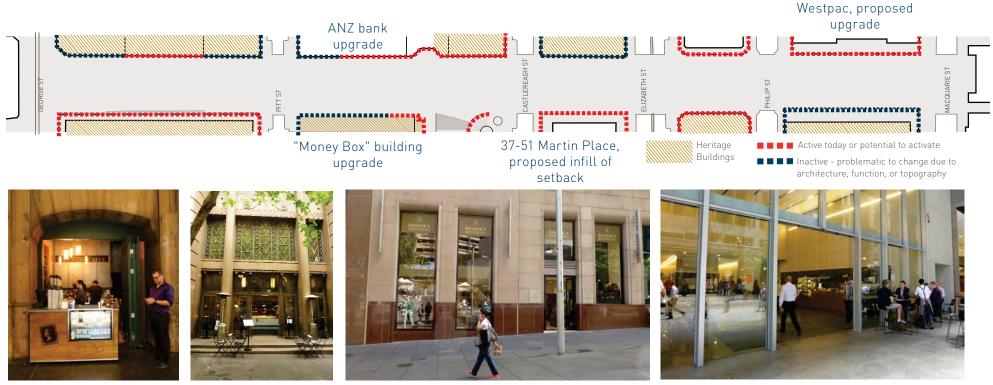

Small coffee shop in the GPO frontage. Pitt Street

Heritage building with active ground floor. 340-346 George Street

Adapted heritage building. Brooks Brothers, 44 Martin Place


Lobbies can be activated by small scale cafés. Pitt Street

Landscape EXISTING CONDITIONS

• 37 trees, primarily plane trees.

- 2 trees of different species at the cenotaph. These are the only trees planted in the median.
- Large sections without trees and shade.
- Limitations to supplement existing tree planting due to underground services and facilities.







Tree planting at the cenotaph.

Double row of plane trees providing shade.


Site dominated by stone materials and absence of trees for shade.

PROPOSAL

- Introduce a coherent avenue of trees
- Strengthen sightlines
- Provide a human scale to the edges
- Trees represent change over the seasons
- Trees represent shading in the summer
- Trees soften the formal feeling of the space
- Keep the central frontage of the GPO clear of tree planting to allow for views to the heritage buildings and allow space around the cenotaph and the poplars.

PREFERRED OPTION/ LONG TERM VISION*

- The long term vision is for all proposed trees to be planted in the ground. In blocks with underground infrastructure this may not be possible until redevelopment occurs. In the short-medium term, planters can be used to introduce soft landscaping to these blocks. Low level planting can be provided in planters where soil depth is not appropriate for tree planting.
- Planter options need to be further investigated to avoid a barrier effect. Landscape elements like the Living Colour displays could be integrated with the seating in a smaller format compared to trees in planters. (See page 43 'Planter seating' for more detail.)

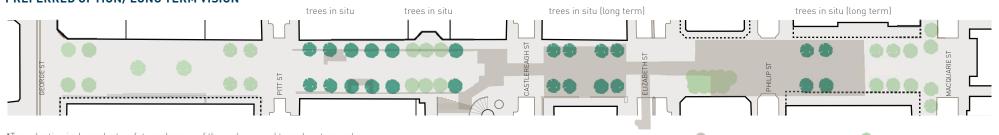

*Tree planting is dependent on future changes of the underground tunnel system and reconfiguration of the existing fountain to achieve trees in situ.

Undergound tunnel system

Existing trees
 Proposed trees



Preferred option: Trees in situ. Due to limited soil this is however hard to achieve with the current configuration of Martin Place. La Rambla, Barcelona, Spain

ALTERNATIVE OPTION/MEDIUM TERM:



Alternative: Combination of seating and landscaping in planter box. Beethovenstraat, Amsterdam, Netherlands.




Alternative: Integrate landscaped elements as part of stairs or as stand alone elements, like e.g. Living Colour. *The Garden that climbs the stairs* by Balmori Associates, public stairs in Bilbao, Spain

Kiosks

EXISTING CONDITIONS

- Overload of kiosks in Martin Place.
- Lack of diversity in products offered.
- Inflexible use.
- Only one coffee outlet with no seating options nearby.
- Lease with JC Decaux expires in 2018. Kiosks will remain until then. Tenants can not be swapped within lease period.




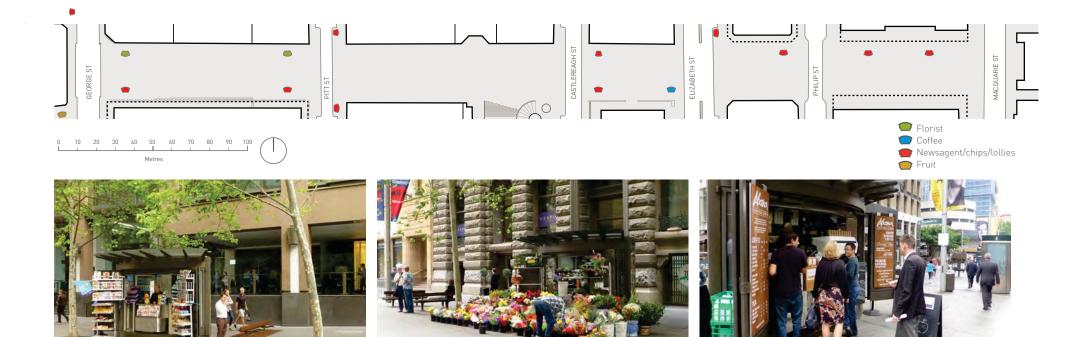


Today there is a lack of diversity in use of the kiosks, with 11 as newsagents. Kiosk goods colonising public space.

Only one coffee kiosk along the entire length of Martin Place

- Reduce the number of kiosks in Martin Place and distribute them evenly throughout the space.
- Place coffee and/or snack outlets in connection with informal seating.
- Introduce pop up kiosks to provide variety and elements of surprise.
- Place kiosks in line with trees to reinforce Martin Place sight lines, and to keep the square open for flexible uses and events.
- Consider a new design for kiosks with colour, scale, form and materials specifically suited to the identity of Martin Place.
- Encourage operating hours to include evenings and weekends to help activate Martin Place and provide surveillance of the place.
- Lighting from kiosks at night will contribute to the perception of safety.

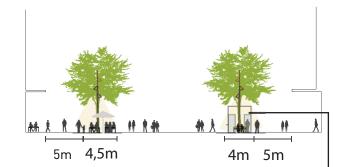



Florist
 Coffee /snacks
 Pop up kiosk
 Fruit

Minimalistic bakery.

San Francisco, US

vorkspace

Café structure. 2 Phillip Street, Sydney



Café structure. 1 Bligh Street, Sydney

POP UP KIOSKS _ TEMPORARY LEASES




Open air library. Austria

Lighting **EXISTING CONDITIONS**

- Ligting consists of smartpoles placed along the full length of Martin Place. Spacing varies along the different sections.
- The smartpoles are tall with two light sources at the very top and have banners, some signage, and a speaker system attached.
- The smartpoles are fitted with cool LED luminaries (Martin Place Lighting Plan).
- Current lighting within Martin Place is highly utilitarian (Martin Place Lighting Plan).
- Martin Place also has facade lighting to some areas.

"Current lighting within Martin Place is highly utilitarian and does not appear to have been designed to articulate the urban and architectural context or enhance the visual atmosphere within the plaza, but rather provide code compliant levels of ligthing for good visibility and safe circulation"

- Martin Place Lighting Plan

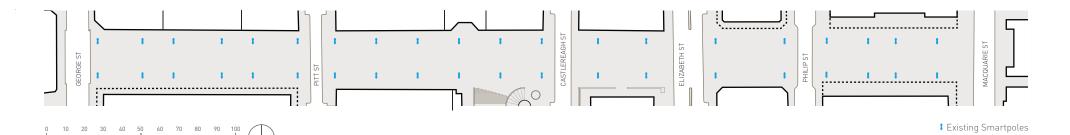



Today: Limited lighting of facades and architecture such as the clocktower.

Existing vision for the future: Enhance the facades and architectural features. Ensure a well-lit walking environment. City of Sydney Martin Place Lighting Masterplan (Steensen Varming 2014)

Metres

- Support a perception of safety throughout Martin Place.
- Celebrate the grand facades of the heritage buildings.
- Encourage modern buildings with glazing to contribute interior lighting.
- Add artistic, poetic elements e.g. lighting of trees or water features.
- Ensure that lighting infrastructure does not create visual clutter during the day, or obstacles for pedestrians.
- Ensure flexible lighting to accomodate both everyday activities and events.
- Consider redesigning smartpoles. A bespoke lighting pole (long term).
- Remove banners due to their visual dominance over the space.
- Create a warm welcoming overall impression of the plaza at night time

MARTIN PLACE LIGHTING PLAN

- Creates a strong sense of place
- Aims to ensure a cohesive, sustainable approach to the lighting of Martin Place and encompasses facades, temporary events, landmarks, urban objects, and pedestrian area lighting
- Considers the different zones of movement and the various lighting needs
- The lighting system should be sustainable and energy efficient
- Lighting treatments should create a harmonious urban context throughout Martin Place
- The lighting plan also incorporates the crossing streets, thus ensuring good quality, safe access along Martin Place



The main lighting from inside or outside is based on lacade type - heritage, modern glazed or unglazed.



Subtle and poetic to create variation Dramatic lighting to enhance water in the paving, or as extra wayfinding features



Transparent facades contribute life and light to the street



Enhance grand heritage facades and their unique features




A future lighting scheme needs to ensure appropriate lighting in all the different zones of Martin Place.

Public seating

EXISTING CONDITIONS

- Few benches.
- Benches placed in north/south direction due to topographic conditions.
- Benches located quite far apart which is appropriate for fine for sitting alone or side by side, however very few seating options are available for larger groups
- Benches lack anchoring to other urban elements and feel uncomfortable due to their exposed nature.
- Large amounts of secondary seating (e.g. people sitting on stairs or ledges) imply a need for more frequent benches.
- 30% of visitors come to Martin Place in order to sit, relax, eat, and socialise. 18% rated 'more benches' as the priority for future additions to the space. (*Martin Place Intercept Survey 2014*)



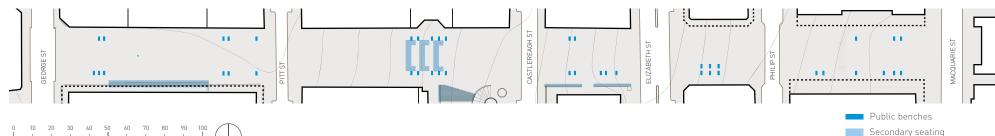



The benches are not 'anchored' to anything and are often located far from other attractions such as fountains.



Existing benches are not used to their full potential due to design issues - low backrests make it inconvenient for 6 people to use the bench at the same time.



Secondary seating is widespread due to the lack of benches available


Metres

The sections of Martin Place differ from each other, hence there is a need to explore various options for public seating. These can then be combined. All options should fulfill the following requirements:

- Provide a large number of benches, variation of invitations to stay
- Fixed benches to be placed in tree planting and landscape zones to maximize the usage of the open areas.
- Flexible seating (semi-permanent) in central areas in connection with water features. Option to be removed during large events.
- Provide options sitting alone, sitting in a group, talkscape, standing

THREE MAIN PRINCIPLES FOR PUBLIC SEATING

- Sydney bench as the primary seating option
- Planter seating in sections where trees can not be achieved
- Flexible seating primarily located in the middle zone

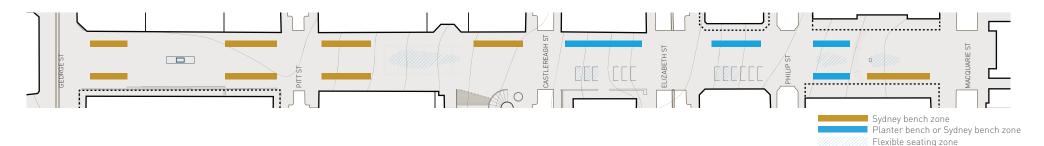

PUBLIC SEATING TYPES



The Sydney public bench.



Landscaped seating that takes up the topography and adds low level greenery to the space. Delft, Netherlands



Provision of flexible seating alternatives. Times Square, New York, USA.

Public seating

City of Sydney has had a suite of furniture designed for the public spaces in the city. This furniture is gradually being introduced across the city.

Positive aspects of using this bench design is that it supports a unified design when used throughout public spaces in Sydney, which also helps making maintanence easier.

The bench is quite small and slender and needs to be placed in pairs or used strategically with other urban elements in a place as large as Martin Place.

At the same time the Sydney bench offers variety in possibilities for creating different seating arrangements and works well in the steeper topography too.



FOR A COMFORTABLE MICROCLIMATE

Place the Sydney bench on each side of the trees to strengthen the linear space, minimize obstacles and achieve a good microclimate



FOR VIEWING A GREAT SPACE

The GPO section of Martin Place is the flattest - here the bench can be placed along the space as well to enhance the feeling of the space as a plaza.

THE SYDNEY BENCH - VARIETY THROUGH PLACEMENT



FOR SOCIAL SITTING

By at some places placing the benches nearer to eachother, create a social seating option. Don't do this too often since, if one person sits alone in one of these two benches it can give the feeling that 'the seat is taken'



SITTING NEAR OR APART

The perpendicular placement that works well in front of the GPO also gives the user a choice to sit close and talk privately or sit apart and have their own personal space.

THE SYDNEY BENCH



The Sydney public bench designed by Alex Tzannes and part of the Street Design Codes.



The Sydney public bench is currently only installed in Kent Street.




The Sydney bench can be placed back to back or on an angle to create more direct views towards the plaza

Planter seating

To integrate planting in Martin Place on a medium term, planters with integrated seating can be introduced in areas where trees cannot be planted in ground due to underground infrastructure. The planters should not be too long - or they become an obstacle. With this in mind, as well as the advice from the arborist regarding soil demands of plane trees, the recommendation is to use low level plants when introducing planter seating in Martin Place. In the future when soil depths can be fully explored, it may be possible to replace low level plants with appropriate tree-types recommended by the arborists.

- Take up features of existing design in Martin Place, such as the wood used in the Sydney Bench for the planter seats
- Corten steel is an option for planter base, a material that adds colour and and works well with planting and a wooden seat. Explore other ideas from the existing palette test with the Sydney Bench. of the characteristic 'Living colours' planters that could be developed to integrate seating.
- Use native species or species that are well suited for the climate and can manage in periods of drought.
- A possibility could be to connect Martin Place to the botanical garden by introducing some durable species from the gardens in the planters, and also some small signs telling about the species present.

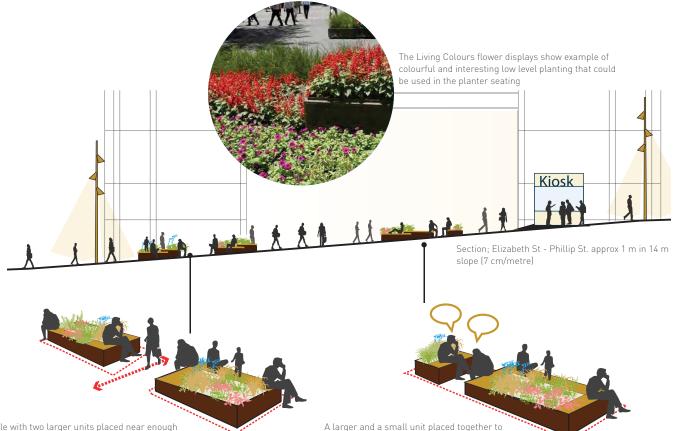

thev meet.

Example with two larger units placed near enough to read as a couple, but 2 m apart in order to allow for walking through. Can still be experienced as one larger obstacle



Landscaped seating that takes up the topography and adds low level greenery to the space. Delft, Netherlands



create a unity and social seating space were

A more organic form is an option. The round corten steel base of *The Garden that climbs the stairs* by Balmori Associates, follows the landscape. Bilbao, Spain

Flexible seating

A COMPLEMENT TO THE FIXED SEATING

The flexible seating can instantly be rearranged to fit with social requirements of its users. It represents a quick way to adapt the public plaza as needed and invites visitors to inhabit the space in a new way. A consistent style of flex-furniture should be adapted for Martin Place to ensure quality, identity, and visual cohesion. This should be selected on coordination with guidelines for outdoor dining furniture.

COMPLETELY FLEXIBLE AND EASY TO MOVE

- Easy to move around into different social seating formations
- Easy to remove when needed for events or to be included as part of events
- Care should be taken when using chairs in particular contexts near stairs etc.

Potential need for storage

Ability to test and evaluate different placements and move if needed



Café style flex seating in bright colours can quickly change the appearance of a space and provide good contrasts to grey paving.



Slightly reclined movable seat which is robust and heavy, with arm-rests.

FIXED - BUT REMOVABLE

The city has control over the placement and there is certainty that no chairs will end up in the middle of a walking zone or in front of entrances

Safe - no risk of chairs falling down steps.

Loses some of the playfulness and spontaneity of the flex seating



Robust chairs that are fixed to the ground. They are not as flexible but a good complement to other public benches. Comfortable and accessible with solid arm rests.




Outdoor dining & cafes

EXISTING CONDITIONS

- Very few outdoor café seats
- Mixed quality furniture
- Too dispersed to create a destination
- Surrounds are difficult noise & cars moving through.
- Martin Place is currently not a weekend destination (limited trade).
- The place feels formal



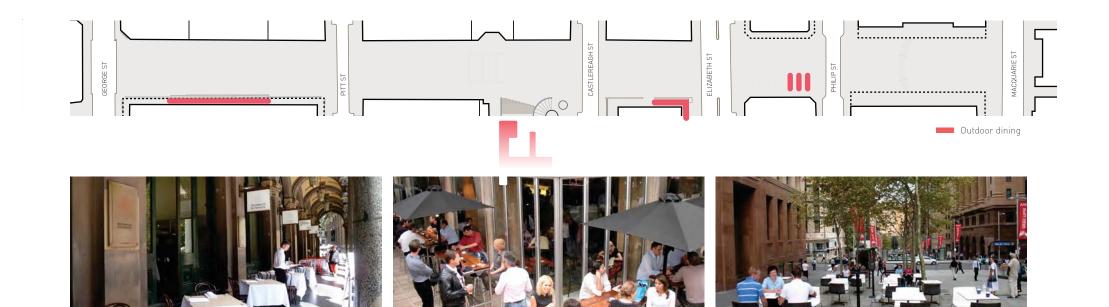

Dining in the colonnade. GPO


46 Gehl Architects — Urban Quality Consultants


Martin Place bar

Sunken outdoor serving area.

Café seating on a terraced area. LIndt Café

- Ensure flexibility in legislation to allow for conversion to outdoor dining.
- Streamline outdoor furniture per block to ensure high quality.
- Support outdoor dining with complementary activation of the square.
- Ensure formal outdoor dining areas and informal public seating for people buying take away coffees and food (middle section).
- Provide umbrellas where needed during the hottest summer months.
- Take advantage of the sunlit areas along the southern facades.
- Introduce guidelines for outdoor serving colours, materials, types where deviations are subject to approval.
- Ensure all elements for outdoor serving are not fixed and are removable.

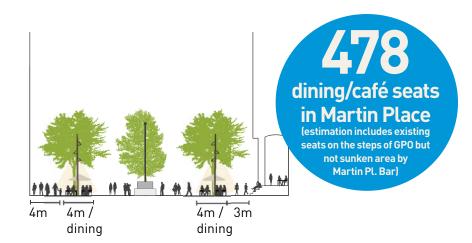

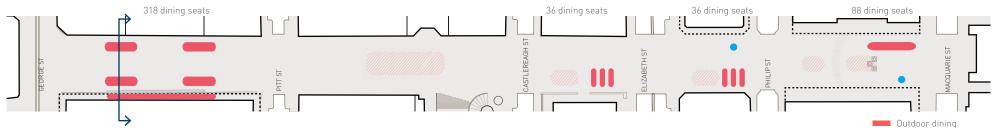

* The defined outdoor dining zones are not exclusive, but subject to future evolution of Martin Place.



Create guidelines for commercial outdoor café seating, with a common design for tables and chairs as well as umbrellas.

Cane chairs with wooden tables and white umbrellas with wooden structure offer a coherent experience for the users. Copenhagen, Denmark

Flexible public seating

Coffee/snacks kiosk







Fountains

EXISTING CONDITIONS

- There are three existing water features in Martin Place today. In general there are very few water features in Sydney so this is a quality in itself.
- The fountain at Pitt Street is outdated and acts as a visual and physical barrier.
- The splashing bowls at Macquarie Street have a good sensory quality. ٠
- Make sure water installations work practically, in windy weather etc. •
- The water installation closest to Macquarie Street (entitled 'Passage' ٠ by Anne Graham) operates subject to wind conditions to prevent wetting pedestrians in windy weather

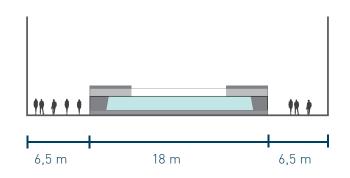

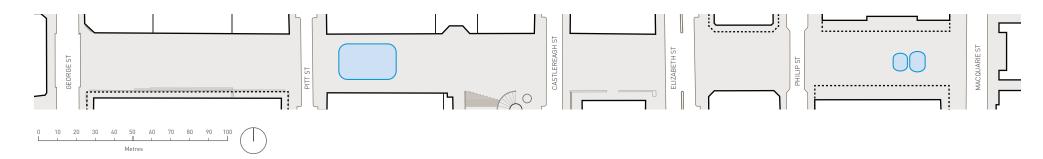



Pitt Street fountain enhances the urban quality of Martin Place, but creates a visual and physical barrier for pedestrians.

The playful water bowls near Macquarie Street are part of the water theme "Passage" fountain near Macquarie Street. of Martin Place, and work well from a human scale perspective.

- Keep water elements in Martin Place to maintain the identity of the place, and to strengthen links to Sydney as a waterfront city.
- Use water elements to break up the extensive hard surfaces.
- Explore the potential of fountains to highlight the significant topography.
- A water feature at Pitt Street is a reminder of the tank stream.
- Introduce an interactive water feature that invites children to play.
- Provide a new water feature that is flexible and does not create a barrier, as well as one that can be turned off to extend useable areas during special events and gatherings





5m

5m



Proposed new water feature.



When lit up at night, water jets create an ethereal atmosphere



Water jets as an interactive and playful element.






Memorials

EXISTING CONDITIONS

- There are two existing memorials at either end of Martin Place. The Cenotaph commemorates WWI and the Commando Memorial commemorates WWII.
- Events on Memorial Day and on Anzac Day occur at the Cenotaph, which has significant conservation status.
- The recent guard railing around the Cenotaph has been introduced to deter passers-by from lingering around the memorial, however the visual appearance of the railings is far from a desired outcome.
- The recent siege in Martin Place will most likely have a memorial in Martin Place.

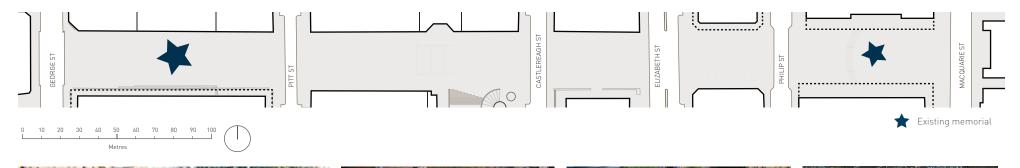



The Cenotaph in the western section of Martin Place is significant for Memorial Day and Anzac Day ceremonies. The recent guard railing around the memorial is not the most appropriate solution.




Commando Memorial, World War II in the far Eastern section.



The recent incident at the Lindt Café, where two people lost their lives, sparked a powerful public response. The design process for a memorial is currently being considered by the Premiers office.

- Ensure all existing or proposed memorials are integrated in a meaningful way in the future redevelopment of Martin Place.
- Ensure all new memorials complement Martin Place.
- Focus on developing memorials that are integrated into the urban fabric of Martin Place, rather than being isolated objects.
- Ensure the placement and design of new memorials will not hinder future improvements to Martin Place.
- Investigate replacement options for the guard railing around the Cenotaph to enhance the overall experience of the memorial.
- Avoid eroding the significance of the Cenotaph. Avoid placing visually competing memorials nearby.

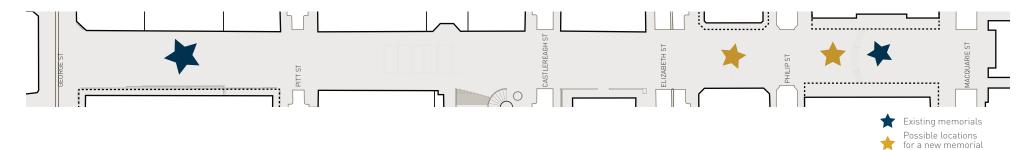



Water jets and paving details commemorating lives lost. Liverpool, England



Feature lighting in paving depicting a star sign. Place du Molard, Geneva, Switzerland




A garden could be integrated into the steps of the far Eastern section. Climbing Garden, Bilbao, Spain

Martin Place as an event space

EXISTING CONDITIONS

- During 2014, up to 20 different events occurred per month in Martin Place.
- The events are spread throughout the year, with July October being the busiest. Sometimes two events take place at different places.
- The events range in scale and visitor numbers.
- The events vary greatly with promotional events mixed with fundraising, awareness-raising, and entertainment of different types.
- Studies show that cultural events are favoured both by the owners group and the public.
- Visitors prefer more markets, performances, and commemorative events.
- Noise and visual clutter can be an issue during events.

39% of intercept survey respondents had visited Martin Place for an event

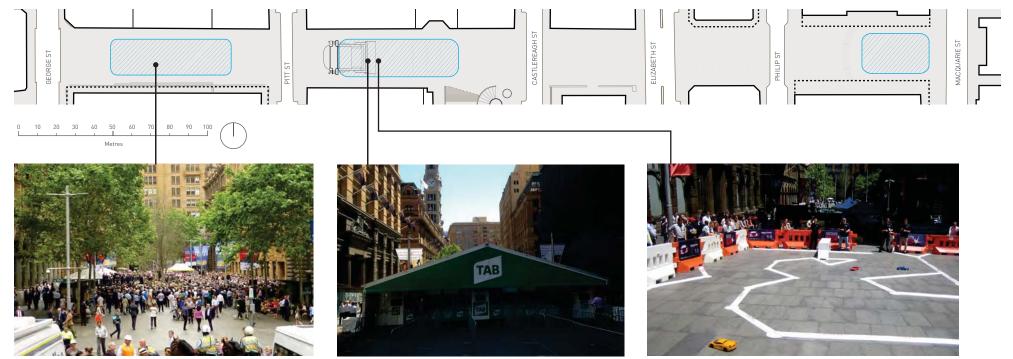

Memorial Day draws thousands of people into Martin Place, who gather around the Cenotaph.

A less visually attractive event in Martin Place.


Martin Place hosts various types of events of a more or less formal setup. The orange and white barriers is the typical way of marking any event.

Develop event guidelines for Martin Place in keeping with the following principles:

- Focus events in Blocks 1, 2 and 5, contained within the footprints indicated below and on detailed plans
- Ensure that all events provide a contribution to the cultural life of the City
- Ensure that events are consistent with the character of Martin Place and their specific location
- Encourage more curated events
- Offer events for a wide audience ensure variety. Offer more events for children and younger audiences
- Ensure that event infrastructure is high quality, including barriers, signage, temporary structures etc.
- Minimise the visual impact of signage and branding
- Consider the acoustic impact of events on surrounding buildings and uses

Increase wayfinding and legibility to the Domain to encourage more and larger events there, reducing pressure on Martin Place.

Martin Place Inception Survey - Preferred event types %

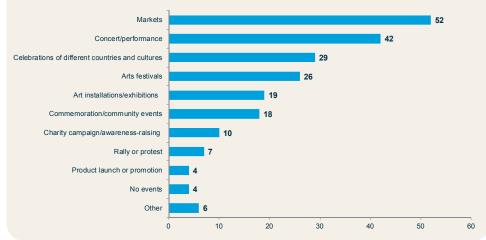

for the Christmas tree



Cultural events, and in particular, concerts and performances are one of the most preferred events. Jazz concert, Copenhagen

Invite all age groups

Evening events to activate the space after dark

Before

180

11

a

THE GLOW BUSINES TECHNOLOW EVENT

cebitcon.au

Difficult Partner state www.sert scales of based

S Maran Pl

1



DETAILED PLANS

George St - Pitt St

SECTION A

facade


Some longer larger benches combined with


А


•

shorter segments creating options for sitting together and talking, or sitting alone reading, or people-watching ('Brighton style' bench) • Allow great views over the plaza or events taking place • Ensure not to create extensively long sections of benches - these create barriers to movement 1 4 1111 A • Long benches along the street are suitable for the flattest areas of Martin Place 3m / 3m / 3m 4m 4m / 4m / 4m bench Cenotaph bench dining zone zone В А Outdoor dining Event space Outdoor dining Event space Pop up business S 8888888 8888 8888 00000000 Event space ຄຸ່ຊຸດຊຸດຊຸດ នេទនទេនាំ <u>ROBO</u> OS Benches placed perpendicular to each other create opportuni-Outdoor dining Outdoor dining ties to sit close together and talk or apart. Existing outdoor dining along

B

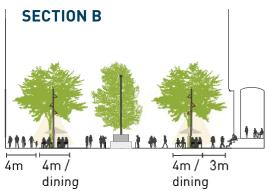

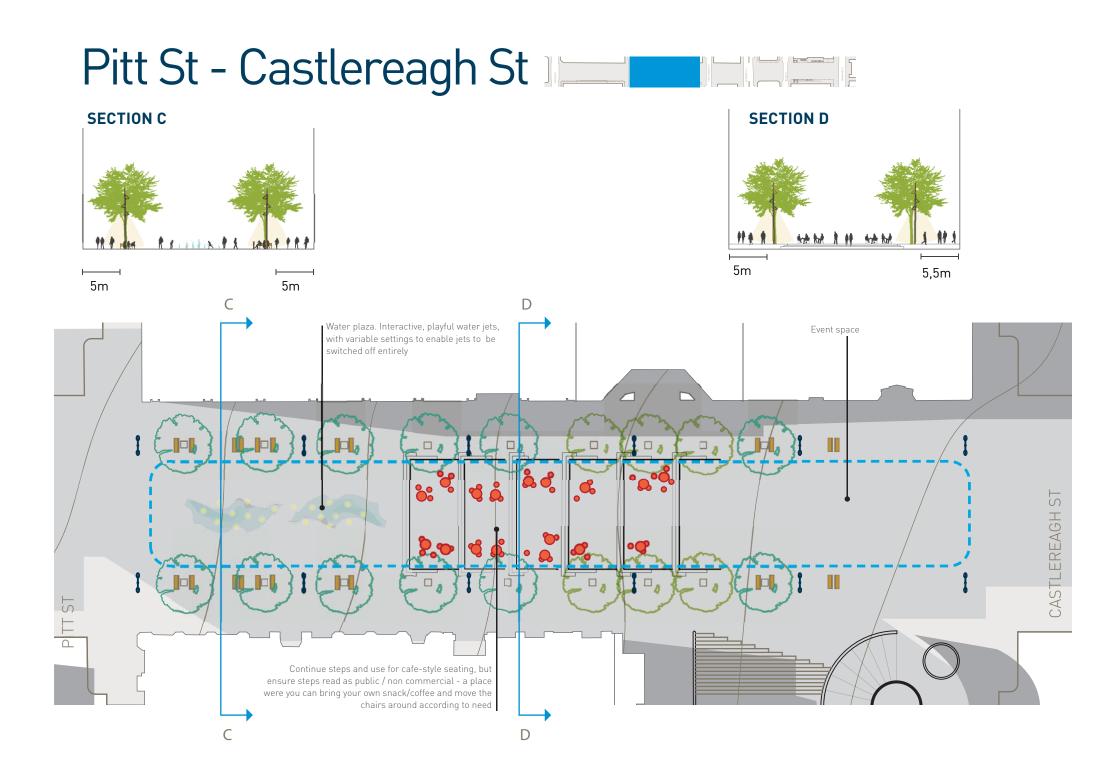

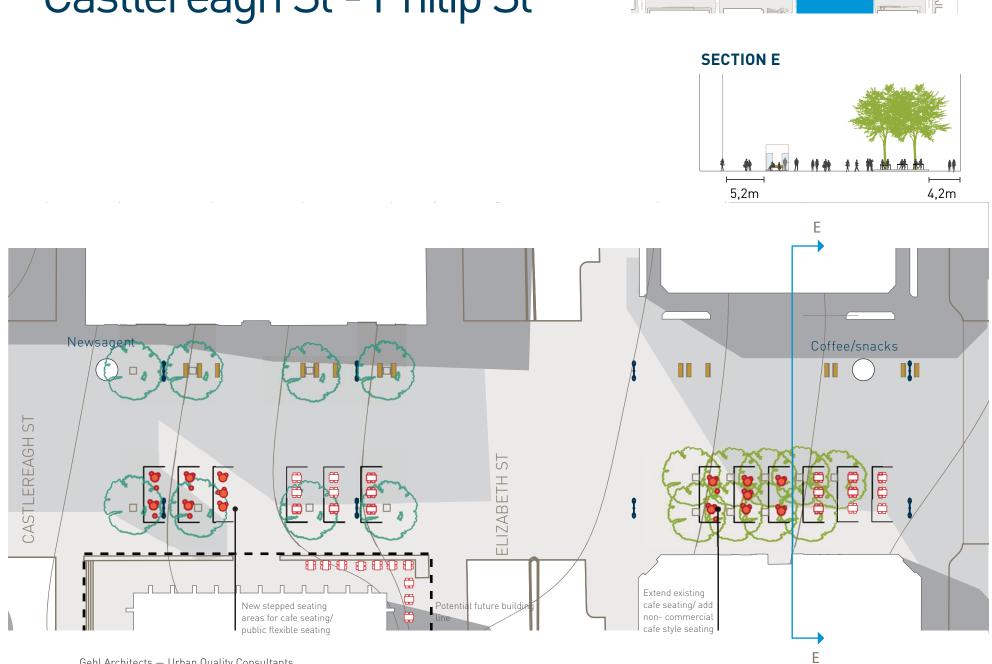


THE REAL PROPERTY.

Castlereagh St - Philip St

Gehl Architects — Urban Quality Consultants

Philip St - Macquarie St

SECTION F

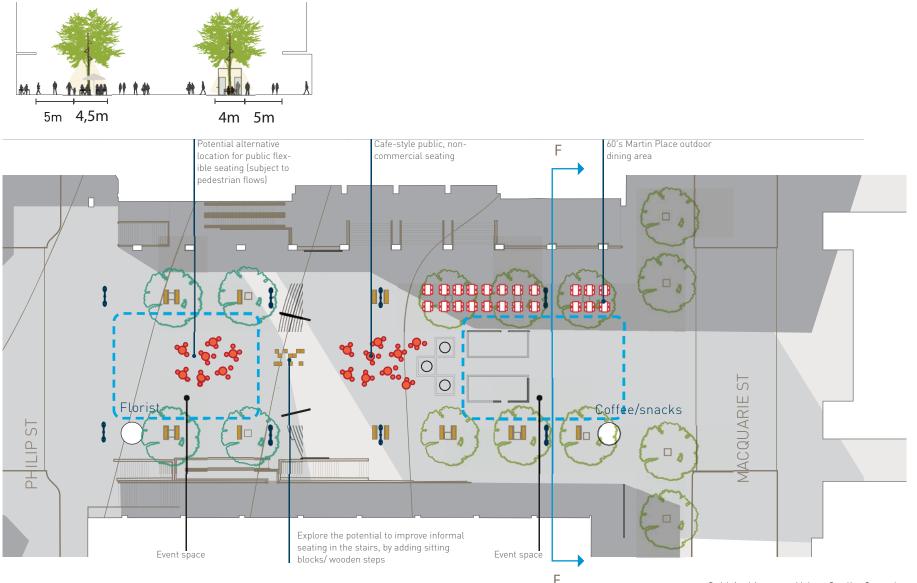

PHASING

SHORT TERM; commence within 2 years

- Benches; replace and supplement
- Memorial
- Flexible seating
- Event guidelines
- Continuous flush paving through crossings
- Activation of built edges
- Kiosk strategy
- Street trees /landscaping

MEDIUM TERM; commence within 5 years

- Fountain Renewal
- Changes to steps /topography
- Lighting; implement the lighting masterplan

LONG TERM; 5+ years

• Station; relocation of station entries